

## Recall List (Updated 4/7/2026)

### Baby Jogger

**June 10, 2015: NHTSA CAMPAIGN NUMBER: 15C002000 - Owner Documents Printed Incorrectly/FMVSS 213**

Safety Risk: Missing information, undersized text, lack of capitalization and warnings in an incorrect order may affect the consumer's understanding on the proper use of the infant car seat, increasing the risk of injury to the child in the event of a crash.

**Manufacturer: Baby Jogger, LLC**

**Potential Number of Units Affected: 15,103**

**Manufacture Dates: November 3, 2014 – April 30, 2015**

**Summary:** Baby Jogger, LLC (Baby Jogger) is recalling certain City GO Infant Car Seats (models BJ64510 and BJ64529), City GO Base for infant car seat (models BJ80400 and BJ61500); City Mini Infant Car Seat/Stroller Travel Systems (model BJ72510); and Vue Lite Infant Car Seat/Stroller Travel Systems (models BJ70411, BJ70424, and BJ70431). The affected child seats have information on the labels, instruction manual and registration card that is either the wrong size, has an incorrect background color, or is in the incorrect order or is missing. As such, these seats fail to comply with the requirements of Federal Motor Vehicle Safety Standard number 213, "Child Restraint Systems."

**Remedy:** Baby Jogger will notify registered owners and will provide a free replacement infant car seat. The recall began on September 27, 2016. Owners may contact Baby Jogger toll-free at 1-800-241-1848.

**Notes:** Owners may also contact the National Highway Traffic Safety Administration Vehicle Safety Hotline at 1-888-327-4236 (TTY 1-800-424-9153) or go to [www.safercar.gov](http://www.safercar.gov).

### Baby Trend

**May 4, 2023 NHTSA CAMPAIGN NUMBER: 23C004000 - Child Seat Webbing May Fail/FMVSS 213 & 209**

Safety Risk: A child seat that fails to properly restrain a child increases the risk of injury in a crash.

**Manufacturer: Baby Trend, Inc.**

**Potential Number of Units Affected: 2,600**

**Manufacture Dates: December 6, 2021**

**Summary:** Baby Trend, Inc. (Baby Trend) is recalling certain Hybrid 3-in-1 Combination Booster Seat-Desert Blue child seats. The latch assembly webbing that secures the child restraint system to the lower anchorages may fray, which can reduce the strength of the webbing and fail to properly restrain a child in a crash. As such, these child seats fail to comply with the requirements of Federal Motor Vehicle Safety Standard numbers 213, "Child Restraint Systems," and 209, "Seat Belt Assemblies."

**Remedy:** Baby Trend, Inc. will mail owners a replacement latch assembly webbing and installation instructions, free of charge. Owner notification letters are expected to be mailed June 30, 2023. Owners may contact Baby Trend customer service at 1-800-328-7363.

**Notes:** Owners may also contact the National Highway Traffic Safety Administration Vehicle Safety Hotline at 1-888-327-4236 (TTY 1-800-424-9153), or go to [www.nhtsa.gov](http://www.nhtsa.gov).

**December 19, 2016: NHTSA CAMPAIGN NUMBER: 16C008000 - Center Adjuster Rivet May Break/FMVSS 213**

Safety Risk: In the event of a crash, the child seat occupant is at an increased risk of injury.

**Manufacturer: Baby Trend, Inc.**

**Potential Number of Units Affected: 34**

**Manufacture Dates: Hybrid LX 3-in-1 Centennial: July 23, 2016 & Hybrid LX 3-in-1 Kiwi: July 14, 2016**

**Summary:** Baby Trend, Inc. (Baby Trend) is recalling certain Hybrid LX 3-in-1 Centennial booster seats, model number FB58181, manufactured on July 23, 2016, and Hybrid LX 3-in-1 Kiwi booster seats, model number FB48417, manufactured on July 14, 2016. The affected child seats have a center adjuster rivet that may pull through or break if the harness is being used with a child weighing more than 40 lbs. As such, these child seats fail to comply with the requirements of Federal Motor Vehicle Safety Standard (FMVSS) number 213, "Child Restraint Systems."

**Remedy:** Baby Trend will notify owners and replace the child seat or provide a full refund. The recall began on February 13, 2017. Owners may contact Baby Trend customer service at 1-800-328-7363.

**Notes:** Owners may also contact the National Highway Traffic Safety Administration Vehicle Safety Hotline at 888-327-4236 (TTY 1-800-424-9153) or go to [www.safercar.gov](http://www.safercar.gov).

## Britax Child Safety, Inc

### **November 19, 2024 NHTSA Campaign Number: 24C001000 - Incorrect Maximum Weight on Labels/ FMVSS 213**

**Safety Risk:** An incorrect label and user guide may result in an improperly installed child seat, increasing the risk of injury in a crash.

**Manufacturer:** Britax Child Safety, Inc.

**Potential Number of Units Affected:** 1,286

**Manufacture Dates:** July 10, 2024 – July 15, 2024

**Summary:** Britax Child Safety, Inc. (Britax) is recalling certain One4Life Slim ClickTight All-in-One car seats with model numbers E1D197A, E1D197B, E1D197F, and E1D197G. The labels and user guide incorrectly state the maximum rear-facing lower anchor weight. As such, these child seats fail to comply with the requirements of Federal Motor Vehicle Safety Standard number 213, "Child Restraint Systems." The One4Life Slim labels and user guide incorrectly listed 40 lbs. as the maximum rear-facing lower anchor weight. Instead, the maximum rear-facing lower anchor weight should be 35 lbs. in accordance with S5.5.2(l)(3)(i)(C) of FMVSS No. 213. If the One4Life Slim is installed rear-facing using lower connectors with a child weighing over 35 lbs., it may not adequately protect the child from injury in the event of a crash.

**Remedy:** Britax will provide all owners of the One4Life Slim car seat models E1D197A, E1D197B, E1D197F and E1D197G a remedy kit, free of charge. The remedy kit will include a label to be inserted to correct the user guide, replacement labels to be placed over the original on-product labels, and an instruction sheet for application of the remedy labels. Owner notification letters are expected to be mailed December 18, 2024. Owners may contact Britax customer service at 888-427-4829.

**Notes:** Owners may also contact the National Highway Traffic Safety Administration Vehicle Safety Hotline at 1-888-327-4236 (TTY 1-800-424-9153) or go to [www.nhtsa.gov](http://www.nhtsa.gov).

### **June 15, 2017: NHTSA CAMPAIGN NUMBER: 17C002000 - Chest Clip Tab may Break and be a Choking Hazard**

**Safety Risk:** The broken tab may present a choking hazard to an infant in the car seat, increasing the risk of injury.

**Manufacturer:** Britax Child Safety, Inc.

**Potential Number of Units Affected:** 207,037

**Manufacture Dates:** November 11, 2015 – May 31, 2017

**Summary:** Britax Child Safety, Inc. (Britax) is recalling certain B-Safe 35, B-Safe 35 Travel Systems, B-Safe 35 Elite, B-Safe 35 Elite Travel Systems and BOB B-Safe rear-facing infant child safety seats, model numbers E1A183F, E1A185M, E1A185P, E1A186R, E1A203F, E1A205M, E1A205P, E1A206X, E1A206Z, E1A207E, E9LU65V, E9LU66X, E9LU66Z, E9LU67D, E9LU67E, EXA185M, S02063600, S02063700, S03803400, S03803500, S03803700, S03803800, S03803900, S04144400, S04144500, S04144600, S04145000, S04402800, S04884200, S04884300, S04975600, S04978900, S05260200, S06020300, S06020400, S06020500, S06020600, S06020700, S06020800, S06020900, S06147100, S921800, E1A215T, E1A215U, E1A216P, E1A221Q, E1A225C, E1A225U, E1A226L, E9LS51Q, E9LS56C, E9LS56L, E9LS57F, E9LS57G, E9LS57H, EXA216L, S01298600, S02063800, S02063900, S02064000, S04281200, S04281300, S04628500, S06018800, S06020000, S06020200, S923700, E9LT34A, E9LT34C, E9LT35X and EXLT34A. The affected child safety seats have a center tab on the chest clip marked "ABS" that may break.

**Remedy:** Britax will notify owners and will provide a replacement chest clip marked "PC", free of charge. The recall began on June 21, 2017. Owners may contact Britax at 1-833-474-7016 or visit [www.bsaf35clip.com](http://www.bsaf35clip.com).

**Notes:** Owners may also contact the National Highway Traffic Safety Administration Vehicle Safety Hotline at 1-888-327-4236 (TTY 1-800-424-9153) or go to [www.safercar.gov](http://www.safercar.gov).

## Chicco USA, Inc

### **March 27, 2025 NHTSA CAMPAIGN NUMBER: 25C005000 - Child Seat May Allow Excessive Movement**

**Safety Risk:** A child seat that fails to properly restrain a child increases the risk of injury in a crash.

**Manufacturer:** Chicco USA, Inc.

**Potential Number of Units Affected:** 30,984

**Manufacture Dates:** September 1, 2020 - August 31, 2024

**Summary:** Chicco USA, Inc. (Chicco) is recalling certain MyFit Zip Air Harness and Booster child restraint seats (CRS) with model numbers 07079561970070 and 04079561190070. In certain configurations, the child seat may allow excessive chest movement in a crash. As such, these child seats fail to comply with the requirements of Federal Motor Vehicle Safety Standard number 213, "Child Restraint Systems."

**Remedy:** The remedy is currently under development. Artsana USA, Inc. is currently exploring potential remedies including amended instructions including recline positions. Note: The MyFit Zip Air is no longer being manufactured as of August 2024. The manufacturer has not provided a schedule for recall notification. Owners may contact Chicco's customer service at 1-877-424-4226.

**Notes:** Owners may also contact the National Highway Traffic Safety Administration Vehicle Safety Hotline at 888-327-4236 (TTY 888-275-9171) or go to [nhtsa.gov](http://nhtsa.gov).

## Clek, Inc

### **June 7, 2022: NHTSA CAMPAIGN NUMBER: 22C002000 - Installation Diagram Missing/FMVSS 213**

**Safety Risk:** A missing installation label may result in an improperly installed child seat, increasing the risk of injury in a crash.

**Manufacturer:** Clek, Inc.

**Potential Number of Units Affected:** 11,123

**Manufacture Dates:** Olli: January 20, 2020 – May 10, 2022 & Ozzi: March 1, 2020 – May 10, 2022

**Summary:** Clek, Inc. (Clek) is recalling certain Olli booster seats, model number OL12U2 manufactured between January 20, 2020 and May 10, 2022, and Ozzi booster seats model number OZ11U2, manufactured between March 1, 2020 and May 10, 2022. The installation diagram displaying the proper way to install the booster seat with a continuous-loop lap/shoulder belt is missing. As such, these child seats fail to comply with the requirements of Federal Motor Vehicle Safety Standard number 213, "Child Restraint Systems."

**Remedy:** Clek will mail owners a new label, free of charge. Owner notification letters are expected to be mailed, beginning July 25, 2022. Owners may contact Clek's customer service by email at [olliozzilabel@clekinc.com](mailto:olliozzilabel@clekinc.com) or by telephone at 1-866-656-2462.

**Notes:** Owners may also contact the National Highway Traffic Safety Administration Vehicle Safety Hotline at 1-888-327-4236 (TTY 1-800-424-9153) or go to [www.nhtsa.gov](http://www.nhtsa.gov).

### **December 20, 2021 NHTSA CAMPAIGN NUMBER: 21C007000-Label Can Come Apart and May Pose Choking Hazard**

**Safety Risk:** Detached pieces of the labels can present a choking hazard to a child, increasing the risk of injury.

**Manufacturer:** Clek, Inc.

**Potential Number of Units Affected:** 596

**Manufacture Dates:** Liing: March 27, 2019 – September 14, 2020; Liingo: May 5, 2020 – September 14, 2020

**Summary:** Clek, Inc. (Clek) is recalling certain Liing, model LG19U1, and Liingo, model number LGO20U1, infant child seats manufactured before February 22, 2021. The labels on the seat cover or infant insert may bubble up, allowing the labels to come apart into small pieces.

**Remedy:** Clek will provide a replacement seat cover or infant insert, free of charge. Owner notification letters were mailed January 31, 2022. Owners may contact Clek customer service at 1-866-656-2462.

**Notes:** Owners may also contact the National Highway Traffic Safety Administration Vehicle Safety Hotline at 1-888-327-4236 (TTY 1-800-424-9153), or go to [www.nhtsa.gov](http://www.nhtsa.gov).

### **December 1, 2021: NHTSA CAMPAIGN NUMBER: 21C005000-Loose Foam in Child Seat May Become Choking Hazard**

**Safety Risk:** Loose pieces of foam can present a choking hazard to a child, increasing the risk of injury.

**Manufacturer:** Clek, Inc.

**Potential Number of Units Affected:** 150,599

**Manufacture Dates:** December 3, 2012 – May 20, 2021

**Summary:** Clek, Inc. (Clek) is recalling certain Foonf, model numbers FO12 through FO19, and Fllo, model numbers FL15 through FL19, convertible child seats manufactured prior to May 21, 2021. A child may pick pieces of foam from the foam cushion located under the seat pad.

**Remedy:** Clek will provide a molded plastic insert that prevents access to the foam, along with instructions on how to attach it to the child seat, free of charge. Owner notification letters were mailed January 28, 2022. Owners may contact Clek customer service at 1-866-656-2462.

**Notes:** Owners may also contact the National Highway Traffic Safety Administration Vehicle Safety Hotline at 1-888-327-4236 (TTY 1-800-424-9153) or go to [www.nhtsa.gov](http://www.nhtsa.gov).

### **December 1, 2021: NHTSA CAMPAIGN NUMBER: 21C006000 - Child Seat Canopy Support May Pose Choking Hazard**

**Safety Risk:** A detached piece of plastic can present a choking hazard to a child, increasing the risk of injury.

**Manufacturer:** Clek, Inc.

**Potential Number of Units Affected:** 5,504

**Manufacture Dates:** March 27, 2019 – September 14, 2020

**Summary:** Clek, Inc. (Clek) is recalling certain Liing, model number LG19U1, and Liingo, model number LGO20U1, infant child seats manufactured before September 15, 2020. A small plastic portion of the child seat canopy support may break and detach from the seat.

**Remedy:** Clek will provide a replacement canopy support along with instructions on how to replace it, free of charge. Owner notification letters were mailed January 31, 2022. Owners may contact Clek customer service at 1-866-656-2462.

**Notes:** Owners may also contact the National Highway Traffic Safety Administration Vehicle Safety Hotline at 1-888-327-4236 (TTY 1-800-424-9153) or go to [www.nhtsa.gov](http://www.nhtsa.gov).

## Combi USA, Inc

### **March 8, 2021: NHTSA CAMPAIGN NUMBER: 21C001000 - Child Seat Webbing May Fail/FMVSS 213**

**Safety Risk:** A child that is not adequately restrained in a crash has an increased risk of injury.

**Manufacturer: Combi USA, Inc.**

**Potential Number of Units Affected: 13,880**

**Manufacture Dates: May 1, 2016 – August 31, 2019**

**Summary:** Combi USA, Inc. (Combi) is recalling certain Combi BabyRide Infant Car Seats, model 378099 with dates of manufacture of 5/1/2016 thru 8/31/2019. The 1-inch-wide webbing strap used in the center front adjuster to adjust the shoulder harness straps fail the minimum initial breaking strength requirements, and in certain circumstances, may not adequately restrain a child during a crash. As such, these car seats fail to conform to Federal Motor Vehicle Safety Standard (FMVSS) number 213, "Child Restraint Systems."

**Remedy:** Combi will provide owners a replacement strap along with instructions for replacement. Owner notification letters were mailed Jan. 28, 2022. Owners may contact Combi customer service by emailing [customerservice@combiusa.com](mailto:customerservice@combiusa.com).

**Notes:** Owners may also contact the National Highway Traffic Safety Administration Vehicle Safety Hotline at 1-888-327-4236 (TTY 1-800-424-9153) or go to [www.nhtsa.gov](http://www.nhtsa.gov).

### **July 5, 2016: NHTSA CAMPAIGN NUMBER: 16C006000 - Excessive Force Transmitted to Child/FMVSS 213**

**Safety Risk:** In the event of a crash, the seat occupant is at an increased risk of injury.

**Manufacturer: Combi USA, Inc.**

**Potential Number of Units Affected: 39,395**

**Manufacture Dates: January 1, 2009 - June 29, 2016**

**Summary:** Combi USA, Inc. (Combi) is recalling certain Coccoro Convertible Child Restraints, model number 8220, manufactured from January 1, 2009, to June 29, 2016. When the Coccoro car seat is installed in a forward-facing position and only secured with the vehicle's lap belt, excessive force may be transmitted to the car seat occupant in the event of a crash, increasing their risk of injury. As such, these child seats fail to comply with the requirements of Federal Motor Vehicle Safety Standard (FMVSS) number 213, "Child Restraint Systems."

**Remedy:** Combi will notify owners and provide them with a cover to be added to the bottom of the seat, free of charge. The recall began on July 29, 2016. Owners may contact Combi customer service at 1-888-232-3294, or by going to <http://registration.combiusa.com/recall>. Combi's number for this recall is 610. Note: This recall does not affect the use of the Coccoro child restraint when it is installed in a rearward-facing position.

**Notes:** Owners may also contact the National Highway Traffic Safety Administration Vehicle Safety Hotline at 1-888-327-4236 (TTY 1-800-424-9153) or go to [www.safercar.gov](http://www.safercar.gov).

## Cybex

### **February 14, 2025: NHTSA CAMPAIGN NUMBER: 25C002000 - Harness Strap May Detach From Seat**

**Safety Risk:** A detached harness will not properly restrain a child, increasing the risk of injury.

**Manufacturer Columbus Trading-Partners USA, Inc.**

**Potential Number of Units Affected 22,823**

**Manufacture Dates: March 10, 2023 - May 10, 2024**

**Summary:** Columbus Trading-Partners USA, Inc. (CTP) is recalling certain Cybex Aton G, Aton G SensorSafe, Aton G Swivel, Aton G Swivel SensorSafe, Eos and Aton G Swivel Travel System, and Eos and Aton G Travel System child seats. The harness hip anchorage retention hooks may bend, causing the anchor pin to loosen, and the harness strap to detach.

**Remedy:** CTP will mail owners a remedy kit and installation instructions, free of charge. Owner notification letters are expected to be mailed April 4, 2025. Owners may contact CTP customer service at 877-242-5676.

**Notes:** Owners may also contact the National Highway Traffic Safety Administration Vehicle Safety Hotline at 888-327-4236 (TTY 888-275-9171) or go to [nhtsa.gov](http://nhtsa.gov).

### **February 10, 2023 NHTSA CAMPAIGN NUMBER: 23C001000 - Infant Seat Webbing May Fail/FMVSS 213 & 209**

**Safety Risk:** An infant seat belt with insufficient strength may not properly restrain the occupant, increasing the risk of injury in a crash. The 1-inch-wide webbing used in the central front adjuster does not have a breaking strength of not less than 75 percent of the new webbing strength when tested in accordance with S5.1(b) of FMVSS No. 209.

**Manufacturer Columbus Trading-Partners USA, Inc.**

**Potential Number of Units Affected 31,080**

**Manufacture Dates:** Cybex Aton: March 29, 2017 – January 4, 2020

Cybex Aton Q: March 13, 2017 – January 3, 2020

Cybex Aton M: March 7, 2018 – November 1, 2020

Cybex Aton 2: March 29, 2017 – October 27, 2020

Cybex Cloud Q: July 6, 2017 – October 20, 2020

**Summary:** Columbus Trading-Partners USA, Inc. (CTP) is recalling certain Cybex models Aton, Aton Q, Aton M, Aton 2, and Cloud Q rear facing infant seats. Please refer to CTP's recall report for specific model details. The design of the webbing for the central seat belt adjuster allows it to fray, which can reduce the strength of the seat belt. As such, these infant seats fail to comply with the requirements of Federal Motor Vehicle Safety Standard numbers 213, "Child Restraint Systems" and 209, "Seatbelt Assemblies."

CTP/CYBEX has determined that the 1-inch-wide webbing strap used in the center front adjuster to snugly adjust the shoulder harness straps onto the child does not meet the retained strength requirements after hex bar abrasion as specified in FMVSS No. 213, S5.4.1.2(b)(1). If the adjuster webbing becomes frayed or worn, which can reduce the strength of the webbing, the webbing could fail to properly restrain the occupant in the event of a vehicle crash increasing the occupant's risk of injury.

**Remedy:** CTP/CYBEX will mail owners a replacement central seat belt adjuster strap assembly and installation instructions, free of charge. Owner notification letters are expected to be mailed March 13, 2023. Owners may contact CTP's customer service at 1-937-415-3215.

**Notes:** Owners may also contact the National Highway Traffic Safety Administration Vehicle Safety Hotline at 1-888-327-4236 (TTY 1-800-424-9153) or go to [www.nhtsa.gov](http://www.nhtsa.gov).

**April 8, 2022: NHTSA CAMPAIGN NUMBER: 22C001000 - Choking Hazard from Foam in Child Seat Headrest**

**Safety Risk:** Loose pieces of foam can present a choking hazard to a child, increasing the risk of injury.

**Manufacturer:** Columbus Trading-Partners USA, Inc.

**Potential Number of Units Affected: 20,526**

**Manufacture Dates:** November 3, 2017 - August 31, 2018

**Summary:** Columbus Trading-Partners USA, Inc. (CTP) is recalling certain CYBEX Sirona M Convertible Child Car Seat, model numbers 518000385, 518002153, 518000387, 518002145, 518002149, 518002151, and 519000211, manufactured between November 3, 2017, and August 31, 2018. A child may pick pieces of foam from the child seat headrest pad.

**Remedy:** CTP will mail a kit with instructions on how to seal the headrest foam, free of charge. Owner notification letters were mailed May 23, 2022. Owners may contact CTP customer service at 1-877-242-5676.

**Notes:** Owners may also contact the National Highway Traffic Safety Administration Vehicle Safety Hotline at 1-888-327-4236 (TTY 1-800-424-9153) or go to [www.nhtsa.gov](http://www.nhtsa.gov).

## Diono

**March 24, 2021: NHTSA CAMPAIGN NUMBER: 21C002000 - Headrest May Break or Separate/FMVSS 213**

**Safety Risk:** A broken or separated headrest increases the risk of injury during a crash.

**Manufacturer:** Diono

**Potential Number of Units Affected: 6,920**

**Manufacture Dates:** September 5, 2020 – November 30, 2020

**Summary:** Diono is recalling certain Cambria 2 Booster Seats, model numbers 31200-US-01, 31201-US-01, and 31202-US-01. In the event of a crash, a crack between the headrest and backrest can occur, allowing the headrest to separate. As such, these seats fail to comply with the requirements of Federal Motor Vehicle Safety Standard number 213, "Child Restraint Systems."

**Remedy:** Diono will provide a replacement backrest with headrest assembly, free of charge. Diono recommends converting the seat into a backless booster seat until the replacement backrest is installed. Owner notification letters were mailed on May 24, 2021. Owners may contact Diono customer service at 1-855-463-4666.

**Notes:** Owners may also contact the National Highway Traffic Safety Administration Vehicle Safety Hotline at 1-888-327-4236 (TTY 1-800-424-9153) or go to [www.safercar.gov](http://www.safercar.gov).

**September 14, 2017: NHTSA CAMPAIGN NUMBER: 17C003000 - Injury Risk when Seat used with Lap Belt/FMVSS 213**

**Safety Risk:** If the seat is installed with only the lap belt, the child has an increased risk of a chest injury in the event of a crash.

**Manufacturer:** Diono (formerly SUNSHINE KIDS JUVENILE) **Potential Number of Units Affected: 519,052**

**Manufacture Dates:** November 25, 2013 - September 5, 2017

**Summary:** Diono is recalling certain Radian R100, Radian R120, Radian RXT, Olympia, Pacifica, and Rainier convertible and booster car seats. When the seat is installed in the forward-facing position and secured to the car using the lap belt without also using the top tether, the seat may not adequately protect the child from injury in the event of a crash. As such, these child seats fail to conform to the requirements of Federal Motor Vehicle Safety Standard (FMVSS) number 213, "Child Restraint Systems." Only seats manufactured between November 25, 2013, and September 5, 2017, are affected by this recall campaign.

**Remedy:** Diono will notify owners and provide a free remedy kit with an updated instruction manual, energy absorbing pad, as well as a new chest clip, free of charge. The recall began on November 22, 2017. Owners may contact Diono customer service at 1-855-215-4951.

**Notes:** Owners may also contact the National Highway Traffic Safety Administration Vehicle Safety Hotline at 1-888-327-4236 (TTY 1-800-424-9153) or go to [www.safercar.gov](http://www.safercar.gov).

## Dorel Juvenile Group

**April 18, 2025: NHTSA CAMPAIGN NUMBER: 25C006000 - Choking Hazard from Foam in Child Seat Headrest**

**Safety Risk:** Pieces of foam can present a choking hazard to a child, increasing the risk of injury.

**Manufacturer: Dorel Juvenile Group**

**Potential Number of Units Affected 179,845**

**Manufacture Dates: February 28, 2023 – December 31, 2023**

**Summary:** Dorel Juvenile Group (Dorel) is recalling certain Safety 1st Grow & Go Sprint child seats. The included model numbers are CC321GYU, CC321GYUD, CC321GYY, CC321GYYD, CC321HAO, and CC321HAR. The headrest foam pad is not adequately secured, which can allow a child to pick off pieces of foam.

**Remedy:** Dorel will mail a replacement headrest pad assembly kit, free of charge. Owner notification letters are expected to be mailed June 9, 2025. Owners may contact Dorel's customer service at 1-877-657-9546 or [gng-sprint-recall@djgusa.com](mailto:gng-sprint-recall@djgusa.com).

**Notes:** Owners may also contact the National Highway Traffic Safety Administration Vehicle Safety Hotline at 888-327-4236 (TTY 888-275-9171) or go to [nhtsa.gov](http://nhtsa.gov).

**March 12, 2025: NHTSA CAMPAIGN NUMBER: 25C004000 - Incorrect Height Range on Label/FMVSS 213**

**Safety Risk:** An incorrect label may result in an improperly restrained child, increasing the risk of injury in a crash.

**Manufacturer: Dorel Juvenile Group**

**Potential Number of Units Affected: 73,144**

**Manufacture Dates: February 28, 2023 – March 7, 2025: Comfort Ride 3-in-1 Harness Booster**

**May 30, 2023 - March 7, 2025: Boost & Go 3-in-1 Harness Booster**

**July 17, 2023 - March 7, 2025: MagicSquad 3-in-1 Harness Booster**

**January 29, 2024 - March 7, 2025: Boost & Go Essential 3-in-1 Harness Booster**

**Summary:** Dorel Juvenile Group (Dorel) is recalling certain Safety 1st Comfort Ride 3-in-1, Boost & Go 3-in-1, Boost & Go Essential 3-in-1, and MagicSquad 3-in-1 harness booster child seats.

**Model Numbers:**

- Safety 1st Comfort Ride 3-in-1 Harness Booster: BC159GKO, BC159HAA, BC159HBE, BC159HBED, BC159HBH
- Safety 1st Boost & Go 3-in-1 Harness Booster: BC163HAS, BC163HAY
- Disney Baby MagicSquad 3-in-1 Harness Booster: BC167GNT, BC167GNU
- Safety 1st Boost & Go Essential 3-in-1 Harness Booster: BC181HFW, BC181HFWD, BC181HGW

The forward-facing installation label incorrectly states the height range. As such, these child seats fail to comply with the requirements of Federal Motor Vehicle Safety Standard number 213, "Child Restraint Systems."

**Remedy:** Dorel will mail owners a new label, free of charge. The manufacturer has not yet provided a schedule for recall notification. Owners may contact Dorel's customer service at 1-877-657-9546 or [comfort-ride-recall@djgusa.com](mailto:comfort-ride-recall@djgusa.com).

**Notes:** Owners may also contact the National Highway Traffic Safety Administration Vehicle Safety Hotline at 888-327-4236 (TTY 888-275-9171) or go to [nhtsa.gov](http://nhtsa.gov).

**March 14, 2023 NHTSA CAMPAIGN NUMBER: 23C003000 - Insufficient Child Seat Inner Carrier/FMVSS 213**

**Safety Risk:** In the event of a crash, an insufficiently restrained child has an increased risk of injury.

**Manufacturer Dorel Juvenile Group**

**Potential Number of Units Affected 14,510**

**Model Number / Manufacture Dates: Maxi-Cosi Coral XP: IC313 / May 1, 2020 – February 28, 2023-All products**

**Summary:** Dorel Juvenile Group (Dorel) is recalling certain Maxi-Cosi Coral XP Rear-facing Infant Seats with model number IC313. The child seat inner carrier is not sufficient to restrain a child without the use of the outer carrier. As such, these child seats fail to comply with the requirements of Federal Motor Vehicle Safety Standard number 213, "Child Restraint Systems."

**Remedy:** Owners are advised to only use the inner carrier of the Coral XP when it is attached to the outer carrier and installed with or without the base using the vehicle belt restraint system, consistent with the existing instruction booklet and labels. Dorel will offer a refund or replace the child seat, free of charge. Owner notification letters are expected to be mailed April 7, 2023. Owners may contact Dorel's customer service at 1-877-657-9546 or [CoralXPRecall@djgusa.com](mailto:CoralXPRecall@djgusa.com).

**Notes:** Owners may also contact the National Highway Traffic Safety Administration Vehicle Safety Hotline at 1-888-327-4236 (TTY 1-800-424-9153) or go to [www.nhtsa.gov](http://www.nhtsa.gov).

**March 3, 2023 NHTSA CAMPAIGN NUMBER: 23C002000 - Child Seat Lower Anchor Failure/FMVSS 213**

**Safety Risk:** A detached child seat may not properly restrain the occupant, increasing the risk of injury in a crash.

**Manufacturer Dorel Juvenile Group**

**Potential Number of Units Affected 59,450**

**Model Number / Manufacture Dates:**

- Maxi-Cosi Coral XP: IC313 / May 1, 2020 - February 28, 2023
- Maxi-Cosi Infant Base: IC335 / May 1, 2020 - February 28, 2023
- Maxi-Cosi Mico Luxe+: IC370 / January 1, 2022 - February 28, 2023
- Maxi-Cosi Mico XP: IC336 and IC338 September 1, 2020 - February 28, 2023
- Maxi-Cosi Mico XP Max: IC337 / January 1, 2021 - February 28, 2023
- Safety 1<sup>st</sup> OnBoard 35 SecureTech: IC351 / May 1, 2022 - February 28, 2023

**Summary:** Dorel Juvenile Group (Dorel) is recalling certain Safety 1st onBoard 35 Secure Tech, Maxi-Cosi Coral XP, Maxi-Cosi Mico XP Max, Maxi-Cosi Mico XP, Maxi-Cosi Mico Luxe+, and Maxi-Cosi Infant Base child seats. Please refer to Dorel's recall report for specific model numbers. The lower seat anchors used to secure the child seat base may fail, allowing the child seat to detach. As such, these child seats fail to comply with the requirements of Federal Motor Vehicle Safety Standard number 213, "Child Restraint Systems." Dorel has received no reports of injuries related to this noncompliance.

**Remedy:** Owners may continue to use their car seat with the base or with the shell only when secured using the vehicle seat belt consistent with the existing instructions in the manual and labels. A free replacement base will be sent to the owners once available. Owners are advised to only secure their child seat(s) with the vehicle belt restraint system until the seat is remedied.

Owner notification letters are expected to be mailed April 7, 2023. Owners may contact Dorel customer service at 1-877-657-9546 or [RetractableLatchRecall@djgusa.com](mailto:RetractableLatchRecall@djgusa.com).

**Notes:** Owners may also contact the National Highway Traffic Safety Administration Vehicle Safety Hotline at 1-888-327-4236 (TTY 1-800-424-9153), or go to [www.nhtsa.gov](http://www.nhtsa.gov).

**September 8, 2021: NHTSA CAMPAIGN NUMBER: 21C004000 - Potential Head Injury With Lap Belt Use/ FMVSS 213**

**Safety Risk:** If the seat is installed with only the lap belt, the child has an increased risk of injury in the event of a crash.

**Manufacturer: Dorel Juvenile Group**

**Potential Number of Units Affected: 4,000**

**Manufacture Dates: January 1, 2019 - July 31, 2019**

**Summary:** Dorel Juvenile Group (Dorel) is recalling certain Maxi-Cosi Pria 70 Convertible child seats. When the seat is installed in the forward-facing position and secured to the car using the lap belt without also using the top tether, the seat may not adequately protect the child from head injury in the event of a crash. As such, these child seats fail to conform to the requirements of Federal Motor Vehicle Safety Standard (FMVSS) number 213, "Child Restraint Systems."

**Remedy:** Dorel will provide remedy kits containing replacement labels and instruction booklets. The new instruction booklet and replacement labels will reduce the forward-facing internal harness weight to 65 pounds and 49 inches in height. If you were intending to use the car seat for a child that weighs more than 65 pounds or taller than 49 inches, Dorel will provide, at no charge, the Maxi-Cosi Rodi Sport Booster seats rated for children 40-100 pounds and 43 to 57 inches in height. Owner notification letters were issued beginning October 12, 2021. Owners may contact Dorel customer service at 1-877-657-9546 or by email at [Pria85recall@djgusa.com](mailto:Pria85recall@djgusa.com).

**Notes:** Owners may also contact the National Highway Traffic Safety Administration Vehicle Safety Hotline at 1-888-327-4236 (TTY 1-800-424-9153) or go to [www.nhtsa.gov](http://www.nhtsa.gov).

**August 24, 2021: NHTSA CAMPAIGN NUMBER: 21C003000 - Potential Head Injury with Lap Belt use/FMVSS 213**

**Safety Risk:** If the seat is installed with only the lap belt, the child has an increased risk of injury in the event of a crash.

**Manufacturer: Dorel Juvenile Group Potential Number of Units Affected: 119,863**

**Manufacture Dates: January 1, 2019 – August 17, 2021**

**Summary:** Dorel Juvenile Group (Dorel) is recalling certain Maxi-Cosi Pria 85 Convertible child seats. When the seat is installed in the forward-facing position and secured to the car using the lap belt without also using the top tether, the seat may not adequately protect the child from head injury in the event of a crash. As such, these child seats fail to conform to the requirements of Federal Motor Vehicle Safety Standard (FMVSS) number 213, "Child Restraint Systems."

**Remedy:** Dorel will provide remedy kits containing replacement labels and instruction booklets. The new instruction booklet and replacement labels will reduce the forward-facing internal harness weight to 65 pounds and 49 inches in height. If you were intending to use the car seat for a child that weighs more than 65 pounds or taller than 49 inches, Dorel will provide, at no charge, the Maxi-Cosi Rodi Sport Booster seats rated for children 40-100 pounds and 43 to 57 inches in height. Owner notification letters were issued beginning October 12, 2021. Owners may contact Dorel customer service at 1-877-657-9546 or by email at [Pria85recall@djgusa.com](mailto:Pria85recall@djgusa.com).

**Notes:** Owners may also contact the National Highway Traffic Safety Administration Vehicle Safety Hotline at 1-888-327-4236 (TTY 1-800-424-9153) or go to [www.nhtsa.gov](http://www.nhtsa.gov).

## Dorel China America, Inc

### **October 17, 2019: NHTSA CAMPAIGN NUMBER: 19C002000 - Improper Warning Labels/FMVSS 213**

**Safety Risk:** Without the safety warnings and instructions, caregivers may not know the risks or how to properly use the child seat, increasing the risk of an injury in the event of a crash.

**Manufacturer:** Dorel China America, Inc.

**Potential Number of Units Affected: 28,800**

**Manufacture Dates:** February 28, 2019 – February 28, 2019

**Summary:** Dorel China America, Inc. (DCA) is recalling certain Babidéal Storm Booster Car Seats, model BC901BPXL, sold exclusively at Family Dollar Stores. The label attached to the fabric cover may not have the required safety warnings and instructions. As such, these child seats fail to comply with the requirements of Federal Motor Vehicle Safety Standard (FMVSS) number 213, "Child Restraint Systems."

**Remedy:** DCA will notify the registered owners and will provide a replacement fabric cover that has a compliant warning label in place, free of charge. The recall began December 9, 2019. Owners may contact DCA customer service at 1-877-657-9546 or text 1-812-373-6673.

**Notes:** Owners may also contact the National Highway Traffic Safety Administration Vehicle Safety Hotline at 1-888-327-4236 (TTY 1-800-424-9153) or go to [www.safercar.gov](http://www.safercar.gov).

## Evenflo

### **February 25, 2026 NHTSA Campaign Number: 26C002000 Incorrect Information in Spanish Language Manual**

**Safety Risk:** A child of greater weight or height than specified in the correct instructions may be exposed to a greater risk of injury in the event of a crash. Incorrect information in the manual may result in an improperly restrained child, increasing the risk of injury in a crash.

**Manufacturer:** Evenflo Company, Inc.

**Potential Number of Units Affected: 14,020**

**Summary:** Evenflo Company, Inc. (Evenflo) is recalling certain LiteMax Factory Select child seats with model number CS10011198. The weight and height limitations are stated incorrectly in the Spanish language manual.

**Remedy:** Evenflo will mail owners a corrected Spanish language manual, free of charge. Owner notification letters are expected to be mailed March 31, 2026. Owners may contact Evenflo customer service at 1-800-233-5921.

Note: The [correct Spanish manual](#) is also available at

[https://www.evenflo.com/cdn/shop/files/257000137S\\_Inst\\_LiteMax\\_30\\_ES\\_0226.pdf?v=5638690213888498782](https://www.evenflo.com/cdn/shop/files/257000137S_Inst_LiteMax_30_ES_0226.pdf?v=5638690213888498782).

**Notes:** Owners may also contact the National Highway Traffic Safety Administration Vehicle Safety Hotline at 1-888-327-4236 (TTY 1-888-275-9171) or go to [www.nhtsa.gov](http://www.nhtsa.gov).

### **January 20 2026 NHTSA Campaign Number: 26C001000 Child Seat Missing Tether Strap**

**Safety Risk:** A child seat with a missing tether strap may not adequately protect a child in a crash, increasing the risk of injury.

**Manufacturer:** Evenflo Company, Inc.

**Potential Number of Units Affected: 64,031**

**Summary:** Evenflo Company, Inc. (Evenflo) is recalling certain Titan 65 child seats with model numbers CS200312198, CS200311198, 3712198, and 3711198. The child seats may have been manufactured without a tether strap.

**Remedy:** Evenflo will advise owners to inspect their child seat for a tether strap, and Evenflo will mail owners a tether strap with installation instructions, as necessary, free of charge. Interim letters notifying owners of the safety risk are expected to be mailed February 20, 2026. Additional letters will be sent once the final remedy becomes available. Owners may contact Evenflo customer service at 1-800-233-5921.

**Notes:** Owners may also contact the National Highway Traffic Safety Administration Vehicle Safety Hotline at 1-888-327-4236 (TTY 1-888-275-9171) or go to [www.nhtsa.gov](http://www.nhtsa.gov).

### **December 24, 2025: NHTSA CAMPAIGN NUMBER: 25C011000 – Adjustable Recline Mechanism May Shift Out of Proper Position**

**Safety Risk:** A child seat that does not maintain proper recline position may not adequately secure a child in a crash, increasing the risk of injury. Additionally, should another passenger put their hand in the recline mechanism when it shifts out of position, their risk of injury is increased.

**Manufacturer:** Evenflo Company, Inc.

**Potential Number of Units Affected: 74,710**

**Summary:** Evenflo Company, Inc. (Evenflo) is recalling certain All4One child seats. In rear-facing mode, the adjustable recline mechanism may shift out of proper position. As such, these child seats fail to comply with the requirements of Federal Motor Vehicle Safety Standard number 213, "Child Restraint Systems."

**Model Numbers:**

Model Name	Model Number	Date of Manufacturer
All4One DLX Latitude	39312234	July 01, 2022 – October 31, 2022
All4One DLX Reefs	39312240	July 01, 2022 – October 31, 2022
All4One Aries	39312408	January 01, 2022 – June 23, 2023
All4One Aries Pallet	39312408PAL	May 01, 2022 – July 31, 2022
All4One Ophelia	39312409	March 01, 2022 – April 30, 2023
All4One Knight	39312440	March 01, 2022 – March 31, 2023
All4One DLX Kingsley	39312441	January 01, 2022 – February 23, 2023
All4One DLX Kingsley	39312441COM	January 01, 2022 – November 30, 2022
All4One DLX Kingsley	39312441POP	February 01, 2022 – February 28, 2022
All4One DLX Belmont	39312442COM	March 01, 2022 – November 20, 2022

**Remedy:** Evenflo will replace the child seat, free of charge. Owner notification letters are expected to be mailed beginning January 26, 2026. Owners may contact Evenflo customer service at 1-800-233-5921.

**Notes:** Owners may also contact the National Highway Traffic Safety Administration Vehicle Safety Hotline at 1-888-327-4236 (TTY 1-888-275-9171) or go to [www.nhtsa.gov](http://www.nhtsa.gov).

**September 25, 2025: NHTSA CAMPAIGN NUMBER: 25C010000 - Choking Hazard from Foam in Headrest**

**Safety Risk:** A child breaking off pieces of the foam headrest may ingest them, creating a choking hazard, increasing the risk of injury. The headrest is accessible underneath the soft goods cover. The field experience demonstrates that the tape employed to protect against a child picking off pieces of foam does not extend sufficiently far to be fully effective.

**Manufacturer: Evenflo Company, Inc.**

**Potential Number of Units Affected: 324997**

**Summary:** Evenflo Company, Inc. (Evenflo) is recalling certain Gold Revolve360 Slim and Revolve360 Slim child seats manufactured between December 1, 2022, and December 8, 2024. Please refer to the list below of specific model and color information. The headrest foam is not adequately secured away from the child, which can allow the child to pick off pieces of foam.

**Model Numbers:**

Model Name	Model Number	Date of Manufacturer
Gold Revolve360 Slim Amethyst	36812451	March 01, 2024 - November 25, 2024
Gold Revolve360 Slim Amethyst	36812451AZ	July 01, 2024 - October 16, 2024
Gold Revolve360 Slim Obsidian	36812450	August 01, 2023 - August 06, 2024
Gold Revolve360 Slim Obsidian	36812450AZ	April 01, 2023 - December 05, 2024
Gold Revolve360 Slim Obsidian	36812450POP	March 01, 2023 - April 13, 2023
Gold Revolve360 Pearl Gray	36812449	Apr 01, 2023 - October 09, 2024
Gold Revolve360 Slim Pearl Gray	36812449AZ	May 01, 2024 - November 26, 2024
Gold Revolve360 Slim Peridot	36812504	December 01, 2023 - August 07, 2024
Revolve360 Slim Cambridge	36812501	January 01, 2023 - October 31, 2024
Revolve360 Slim Cambridge	36812501A	November 01, 2023 - April 21, 2024
Revolve360 Slim Canton	36812470	February 01, 2024 - November 27, 2024
Revolve360 Slim Canton	36812470A	December 01, 2022 - July 22, 2024
Revolve360 Slim Canton	36812470TGT	July 01, 2024 - September 04, 2024
Revolve360 Slim Carver	36812471	December 01, 2022 - August 15, 2024
Revolve360 Slim Salem	36812467AZ	December 01, 2022 - December 08, 2024
Revolve360 Slim Salem	36812467	December 01, 2022 - December 04, 2024
Revolve360 Slim Stow	36812468AZ	December 01, 2022 - December 01, 2024
Revolve360 Slim Stow	36812468	December 01, 2022 - November 26, 2024
Revolve360 Slim Sutton	36812469	March 01, 2023 - November 28, 2024
Revolve360 Slim Sutton	36812469AZ	September 01, 2023 - November 21, 2024

**Remedy:** Evenflo will supply consumers with a remedy kit including an additional tape seal. When installed by the consumer according to the accompanying instructions, the tape seal will protect against child access to the headrest foam. Owner notification letters are expected to be mailed October 31, 2025. Owners may contact Evenflo customer service at 1-800-233-5921.

**Notes:** Owners may also contact the National Highway Traffic Safety Administration Vehicle Safety Hotline at 1-888-327-4236 (TTY 1-888-275-9171) or go to [www.nhtsa.gov](http://www.nhtsa.gov).

**June 18, 2025: NHTSA CAMPAIGN NUMBER: 25C008000 - Missing Instruction Manual/FMVSS 213**

**Safety Risk:** Consumers who did not receive the correct instructions would not have ready access to accurate information about the proper installation and use of the subject child restraint, increasing the risk of incorrect usage and therefore the risk of injury in the event of a crash.

**Manufacturer:** Evenflo Company, Inc.

**Potential Number of Units Affected: 36,694**

**Manufacture Dates: March 17, 2025 – May 1, 2025**

**Summary:** Evenflo Company, Inc. (Evenflo) is recalling certain Titan 65 child seats.

**Model Numbers:**

- Titan 65: 371298

Identification of any warning that can occur: Where the incorrect instructions were provided, it is apparent because the cover of the instructions would recite a product name different from the subject product.

**Remedy:** Evenflo will give notice to identified purchasers explaining the potential issue, describing how they can check to make sure they have the correct instructions and communicating how they can obtain the correct instructions (free of charge) from Evenflo.

**How remedy component differs from recalled component:** The remedy component instructions are the correct instructions for the subject product, replacing instructions intended for a different product.

**Notes:** Owners may also contact the National Highway Traffic Safety Administration Vehicle Safety Hotline at 888-327-4236 (TTY 888-275-9171) or go to [nhtsa.gov](http://nhtsa.gov).

**March 11, 2025: NHTSA CAMPAIGN NUMBER: 25C003000 - Missing Recall Registration Card/FMVSS 213**

**Safety Risk:** A missing recall registration card may result in an unregistered child seat, which can delay recall notification and increase the risk of injury.

**Manufacturer:** Evenflo Company, Inc.

**Potential Number of Units Affected: 1,068**

**Manufacture Dates: January 1, 2018 – December 31, 2024**

**Summary:** Evenflo Company, Inc. (Evenflo) is recalling certain child seats and travel systems.

**Model Numbers:**

Model Name	Model Number	Date of Manufacturer
Symphony Sport Charcoal Shadow	34512335C	January 1, 2018 – December 31, 2024
Symphony Elite Paramount	34611709C	January 1, 2018 – December 31, 2024
Spectrum Cornerstone	34212036C	January 1, 2018 – December 31, 2024
Symphony DLX Ashland Gray	34612173C	January 1, 2018 – December 31, 2024
Symphony DLX Ocala	34631038C	January 1, 2018 – December 31, 2024
Sonus Lava Red	34712059C	January 1, 2018 – December 31, 2024
Maestro Sport Layton	34912200C	January 1, 2018 – December 31, 2024
Maestro Sport Crestone Peaks	34912258C	January 1, 2018 – December 31, 2024
Tribute Factory Select	3811198C	January 1, 2018 – December 31, 2024
Everystage DLX Canyons	39212241C	January 1, 2018 – December 31, 2024
Gold Shyft Travel System w/ LiteMax Moonstone	53212311C	January 1, 2018 – December 31, 2024
Pivot Travel System w/ Safemax Desert Tan	56012477C	January 1, 2018 – December 31, 2024
Sibby Travel System w/ Litemax ICS Rasp	56211976C	January 1, 2018 – December 31, 2024
Folio3 Travel System w/ Litemax Avenue	57312205C	January 1, 2018 – December 31, 2024
Litemax 35 Base	6391600C	January 1, 2018 – December 31, 2024
Everyfit All4One 3in1 Olympus	CS300212376C	January 1, 2018 – December 31, 2024
Go Time Sport Booster Vail	35012433C	January 1, 2018 – December 31, 2024

Gold Pivot Xpand Modular Travel System w/ LiteMax ICS - Moonstone Gray	53112311C	January 1, 2018 – December 31, 2024
Omni Plus Travel System w/ Litemax - Mylar Gray	53312418C	January 1, 2018 – December 31, 2024
Pivot Xpand Travel System w/ SM Ayrshire BK	57112454C	January 1, 2018 – December 31, 2024
Everykid 3in1 Livingston	CS300212340C	January 1, 2018 – December 31, 2024
Everyfit All4One 3in1 Aries	CS300212408C	January 1, 2018 – December 31, 2024
Big Kid LX Boston	31912381C	January 1, 2018 – December 31, 2024
AMP Performance Red	34011243C	January 1, 2018 – December 31, 2024
Gold Revolve360 Extend Moonstone	38412311C	January 1, 2018 – December 31, 2024

The child seats and travel systems are missing the USA recall registration card. As such, these child seats and travel systems fail to comply with the requirements of Federal Motor Vehicle Safety Standard number 213, "Child Restraint Systems."

**Remedy:** Evenflo will mail owners a recall registration card, free of charge. Owner notification letters are expected to be mailed April 1, 2025. Owners may contact Evenflo customer service at 1-800-233-5921.

**Notes:** Owners may also contact the National Highway Traffic Safety Administration Vehicle Safety Hotline at 888-327-4236 (TTY 888-275-9171) or go to [nhtsa.gov](http://nhtsa.gov).

**September 7, 2016: NHTSA CAMPAIGN NUMBER: 16C007000-Child Can Access/Loosen Harness Adjustment Button**

**Safety Risk:** If the child can loosen the harness, they may not be properly secured in the event of a crash, increasing their risk of injury.

**Manufacturer:** Evenflo Company, Inc.

**Potential Number of Units Affected:** 29,742

**Manufacture Dates:** model # 34411700: February 26, 2015 – February 9, 2016 & model # 34411741: May 27, 2015 – February 9, 2016

**Summary:** Evenflo Company, Inc. (Evenflo) is recalling certain Evolve 3-in-1 Combination Booster Seats, model number 34411700 manufactured February 26, 2015, to February 9, 2016, and model number 34411741 manufactured May 27, 2015, to February 9, 2016. The affected seats have a button for adjusting the harness tightness. The child in the seat can access this button and loosen the harness without the caregiver's knowledge.

**Remedy:** Evenflo will notify the registered owners and will provide a remedy kit with a replacement harness adjustment button, free of charge. The recall began on September 28, 2016. Owners may contact Evenflo at [www.evolve.evenflo.com](http://www.evolve.evenflo.com) or 1-800-233-5921.

**Notes:** Owners may also contact the National Highway Traffic Safety Administration Vehicle Safety Hotline at 1-888-327-4236 (TTY 1-800-424-9153) or go to [www.safercar.gov](http://www.safercar.gov).

## Graco

**April 2, 2026: NHTSA CAMPAIGN NUMBER: 26C003000 Infant seat carrier detaches from the base in a crash**

**Safety Risk:** An infant seat carrier that detaches in a crash increases the risk of injury.

**Manufacturer:** Graco Children's Products Inc.

**Potential Number of Units Affected:** 5,126

**Manufacture Dates:** December 1, 2025 – March 27, 2026

**Summary:** Graco Children's Products Inc. (Graco) is recalling certain SnugRide Turn & Slide and Modes Nest Travel Systems with SnugRide Turn & Slide infant child seats. Please refer to Graco's recall report for specific model information. The infant seat carrier may detach from the base in a crash. As such, these child seats and travel systems fail to comply with the requirements of Federal Motor Vehicle Safety Standard number 213, "Child Restraint Systems." The SnugRide Turn & Slide Rotating Infant car seats, sold in the US by Amazon, Babylist, Target, Walmart, and GracoBaby.com.

**Model Numbers:**

Model Name	Model Number	Date of Manufacturer
Replacement product available at no cost for affected consumers after registration review.		
<b>Option 1:</b> SnugRide SnugFit DLX Maison (2156211) + additional SnugRide SnugFit base (2120612)		
<b>Option 2:</b> SnugRide SnugFit Gotham (2121500) + additional SnugRide SnugFit base (2120612)		
<b>Option 3:</b> EasyTurn Solae (2216076) / <b>Option 4:</b> Turn2Me Brighton (2215409)		
SnugRide Turn & Slide Rotating ICS	<b>2231809</b> Noir / Black	January 1, 2026 – March 31, 2026
SnugRide Turn & Slide Rotating ICS	<b>2231887</b> Sandstone / Tan	January 1, 2026 – March 31, 2026
SnugRide Turn & Slide Rotating ICS	<b>2231806</b> Mulberry / Girl-Plum	January 1, 2026 – March 31, 2026
SnugRide Turn & Slide Rotating ICS	<b>2231885</b> Sandstone / Tan	January 1, 2026 – March 31, 2026

SnugRide Turn & Slide Rotating ICS	<b>2231881</b> Noir / Black	January 1, 2026 – March 31, 2026
SnugRide Turn & Slide Rotating ICS	<b>2231884</b> Noir / Black	January 1, 2026 – March 31, 2026
Included only when the product label matches the affected model number listed here. If you are registering a base-only product (model 2231810), you will receive SnugRide SnugFit base (2120612) only. Base-only registrations are not eligible for full car seat replacement options.		
SnugRide® Turn & Slide Rotating Infant Car Seat Base	<b>2231810</b> Black	January 1, 2026 – March 31, 2026
The stroller is not affected. Both infant car seat replacement options are designed to work with your existing travel system stroller		
Modes Nest Travel System with SnugRide® Turn & Slide ICS	<b>2243083</b> Noir / Black	January 1, 2026 – March 31, 2026

**Remedy:** Owners are advised to follow the instructions for installing the child seat with the vehicle seat belt (without the base) until the replacement seat arrives. Graco will replace the child seat, free of charge. Owner notification letters are expected to be mailed April 2026. Owners may contact Graco customer service at 1-800-345-4109.

Go to <https://recalls.gracobaby.com/> and complete the registration form. Upload a photo of the label with the model number, manufacture date, and serial number. Select one of the replacement options and submit the registration form to Graco for review and if your car seat is affected, your selected replacement will be provided. If you have questions, please contact our Graco Consumer Services team via chat, email or by phone at 1-800-345-4109 between 9 a.m. – 5 p.m. ET, Monday thru Friday.

**Notes:** Owners may also contact the National Highway Traffic Safety Administration Vehicle Safety Hotline at 1-888-327-4236 (TTY 1-888-275-9171), or go to [www.nhtsa.gov](http://www.nhtsa.gov).

**May 10, 2017: NHTSA CAMPAIGN NUMBER: 17C001000 - Child Seat Webbing may Tear Under Load/FMVSS 213**

**Safety Risk:** A child that is not adequately restrained in a crash has an increased risk of an injury.

**Manufacturer: Graco Children's Products Inc.**

**Potential Number of Units Affected: 25,494**

**Manufacture Dates: May 20, 2014 – August 1, 2014**

**Summary:** Graco Children's Products Inc. (Graco) is recalling certain Graco My Ride 65 convertible child restraints, models 1871689, 1908152, 1813074, 1872691, 1853478, 1877535, 1813015, and 1794334. In the event of a crash, the child seat webbing may not adequately restrain the child. As such, these car seats fail to conform to Federal Motor Vehicle Safety Standard (FMVSS) number 213, "Child Restraint Systems."

**Remedy:** Graco will notify owners, and dealers will provide consumers with a replacement harness, free of charge. The recall began on July 7, 2017. Owners may contact Graco customer service at 1-800-345-4109.

**Notes:** Owners may also contact the National Highway Traffic Safety Administration Vehicle Safety Hotline at 1-888-327-4236 (TTY 1-800-424-9153) or go to [www.safercar.gov](http://www.safercar.gov).

**April 25, 2016: NHTSA CAMPAIGN NUMBER: 16C004000 - Printed Instructions Missing Information/FMVSS 213**

**Safety Risk:** In the event of a vehicle crash, an unoccupied and unsecured child restraint may strike other occupants and cause injury.

**Manufacturer: Graco Children's Products Inc.**

**Potential Number of Units Affected: 20,505**

**Manufacture Dates: December 22, 2015 – April 5, 2016**

**Summary:** Graco Children's Products Inc. (Graco) is recalling certain Graco TurboBooster booster seats, models 1967886, 1963973, 1963974, 1963975, 1963976, and 1975173, manufactured between December 22, 2015, and April 5, 2016. The instructions for the booster seats are missing the information that the seats should be securely belted to the vehicle at all times, even if the seat is unoccupied. As such, these seats fail to comply with the requirements of Federal Motor Vehicle Safety Standard (FMVSS) number 213, "Child Restraint Systems."

**Remedy:** Graco will notify registered owners and provide the missing printed instructions, free of charge. Non-registered owners can obtain the missing printed instructions by contacting Graco customer service at 1-800-345-4109. The recall began on June 8, 2016.

**Notes:** Owners may also contact the National Highway Traffic Safety Administration Vehicle Safety Hotline at 1-888-327-4236 (TTY 1-800-424-9153) or go to [www.safercar.gov](http://www.safercar.gov).

## Harmony Juvenile Products

**April 17, 2018: NHTSA CAMPAIGN NUMBER: 18C001000 - Booster Seat Excessive Force/FMVSS 213**

**Safety Risk:** Excessive chest force can increase the risk of injury.

**Manufacturer:** Harmony Juvenile Products

**Potential Number of Units Affected:** 148,165

**Manufacture Dates:** November 1, 2015 – June 24, 2017

**Summary:** Harmony Juvenile Products (Harmony) is recalling certain Harmony Big Boost Deluxe booster seats. In the event of a crash, the seat belt may cause excessive force to be applied to the restrained child's chest. As such, these booster seats fail to comply with the requirements of Federal Motor Vehicle Safety Standard (FMVSS) number 213, "Child Restraint Systems."

**Remedy:** Harmony will notify owners and provide a replacement booster seat of a different model, free of charge to eligible U.S. consumers who currently own a Big Boost unit and are the original purchaser, original owner, and/or original user of the Big Boost unit. Interim notices informing owners of the safety risk were mailed August 21, 2018. The recall began July 3, 2020. Owners may contact Harmony customer service at 1-877-306-1001.

**Notes:** Owners may also contact the National Highway Traffic Safety Administration Vehicle Safety Hotline at 1-888-327-4236 (TTY 1-800-424-9153) or go to [www.safercar.gov](http://www.safercar.gov).

## Kiddy USA

**April 29, 2016: NHTSA CAMPAIGN NUMBER: 16C005000 - Buckle May Only Partially Engage/FMVSS 213**

**Safety Risk:** A partially engaged buckle will not adequately restrain the child in the event of a crash, increasing the risk of injury.

**Manufacturer:** Kiddy USA

**Potential Number of Units Affected:** 1,429

**Manufacture Dates:** July 2, 2012 - October 5, 2013

**Summary:** Kiddy USA (Kiddy) is recalling certain World Plus combination forward facing child restraints that convert to a high back booster seat, model 51 100 WP, manufactured from July 2, 2012, through October 5, 2013. The buckle/tongue on the affected booster seats may only partially engage. As a result, the consumer may have a false impression that the buckle is fully latched when it is not. As such, these seats fail to comply with the requirements of Federal Motor Vehicle Safety Standard (FMVSS) number 213, "Child Restraint Systems."

**Remedy:** Kiddy will notify registered owners and will reimburse owners the full purchase price of the car seat plus packaging costs. The recall began on June 15, 2016. Owners may contact Kiddy customer service at 1-855-92KIDDY (1-855-925-4339).

**Notes:** Owners may also contact the National Highway Traffic Safety Administration Vehicle Safety Hotline at 1-888-327-4236 (TTY 1-800-424-9153) or go to [www.safercar.gov](http://www.safercar.gov).

## Marainbow (JD E-Commerce America Limited)

**December 29, 2022 NHTSA CAMPAIGN NUMBER: 22C008000 - Child Seat May Be Improperly Installed/FMVSS 213**

**Safety Risk:** An incorrect installation label may result in an improperly installed child seat, increasing the risk of injury in a crash.

**Manufacturer** JD E-Commerce America Limited

**Potential Number of Units Affected** 174

**Manufacture Dates:** August 2, 2020 – May 7, 2022



**Summary:** JD E-Commerce America Limited (Joybuy Express) is recalling all Marainbow Portable Infant Safe Seat and materially similar child seats. Please refer to Joybuy Express' affected products attachment for specific child seat model details. The installation labels display incorrect instructions. The child seat's design also prohibits it from being installed properly. As such, these child seats fail to comply with the requirements of Federal Motor Vehicle Safety Standard number 213, "Child Restraint Systems."

**Remedy:** Joybuy Express will provide a refund to purchasers. The manufacturer has not yet provided a schedule for recall notification. Owners may contact Joybuy Express' customer service at 1-302-426-4543.

This recall expands and replaces NHTSA recall number 22C-007.

**Notes:** Owners may also contact the National Highway Traffic Safety Administration Vehicle Safety Hotline at 1-888-327-4236 (TTY 1-800-424-9153) or go to [www.nhtsa.gov](http://www.nhtsa.gov).

**November 28, 2022 NHTSA CAMPAIGN NUMBER: 22C007000 - Incorrect Installation Label and Design/FMVSS 213**

**Safety Risk:** An incorrect installation label may result in an improperly installed child seat, increasing the risk of injury in a crash.

**Manufacturer** JD E-Commerce America Limited

**Potential Number of Units Affected** 174

**Manufacture Dates:** August 2, 2020 – May 7, 2022



**Summary:** JD E-Commerce America Limited (JD E-Commerce) is recalling certain Marainbow Portable Infant Safe Seat child seats. The installation labels display incorrect instructions. The child seat's design also prohibits it from being installed properly. As such, these child seats fail to comply with the requirements of Federal Motor Vehicle Safety Standard number 213, "Child Restraint Systems."

**Remedy:** No remedy has been established at this time. The manufacturer has not yet provided a schedule for recall notification. Owners may contact JD E-Commerce customer service at 1-946-932-0299.

**Notes:** Owners may also contact the National Highway Traffic Safety Administration Vehicle Safety Hotline at 1-888-327-4236 (TTY 1-800-424-9153) or go to [www.nhtsa.gov](http://www.nhtsa.gov).

## Merritt Manufacturing

**November 5, 2019: NHTSA CAMPAIGN NUMBER: 19C003000 - Harness may not Restrain Child in a Crash**

**Safety Risk:** In the event of a crash, the harness may not restrain the bed occupant, increasing their risk of injury.

**Manufacturer: Merritt Manufacturing Inc.**

**Potential Number of Units Affected: 216**

**Manufacture Dates: August 8, 2019 – October 24, 2019**

**Summary:** Merritt Manufacturing Inc. (Merritt) is recalling certain Angel Guard Angel Ride car beds. The restraint harness may not have been properly sewed where the buckle is attached.

**Remedy:** Merritt will notify owners, and will provide replacement harnesses, free of charge. The recall began January 15, 2020. Owners may contact Merritt customer service at 1-317-409-0146.

**Notes:** Owners may also contact the National Highway Traffic Safety Administration Vehicle Safety Hotline at 1-888-327-4236 (TTY 1-800-424-9153) or go to [www.safercar.gov](http://www.safercar.gov).

## Nuna Baby Essentials, Inc

**November 27, 2024: NHTSA CAMPAIGN NUMBER: 24C002000 - Front Harness Adjuster on Child Seat May Fail**

**Safety Risk:** In the event of a crash, the front harness may not restrain the child, increasing their risk of injury.

**Manufacturer Nuna Baby Essentials, Inc.**

**Potential Number of Units Affected: 608,786**

**Manufacture Dates: July 16, 2016 – October 25, 2023**

**Summary:** Nuna Baby Essentials, Inc. (Nuna) is recalling certain Rava child seats with a plastic harness adjuster button, manufactured between July 16, 2016 and October 25, 2023. Please see the recall report for a complete list of model numbers. Debris may enter the front harness adjuster and cause the mechanism to fail, resulting in a loose harness.

**Remedy:** Nuna will provide owners a remedy kit, free of charge. The manufacturer has not yet provided a schedule for recall notification. Owners may contact Nuna customer service at 1-855-686-2891 or via email at [info.usa@nunababy.com](mailto:info.usa@nunababy.com).

**Notes:** Owners may also contact the National Highway Traffic Safety Administration Vehicle Safety Hotline at 1-888-327-4236 (TTY 1-800-424-9153) or go to [www.nhtsa.gov](http://www.nhtsa.gov).

## WAYB

**August 30, 2019: NHTSA CAMPAIGN NUMBER: 19C001000 - Headrest May Break or Separate From Car Seat**

**Safety Risk:** A broken or separated headrest increases the risk of injury during a crash.

**Manufacturer: ForB dba WAYB**

**Potential Number of Units Affected: 6,426**

**Manufacture Dates: February 1, 2019 - August 23, 2019**

**Summary:** ForB dba WAYB (WAYB) is recalling certain WAYB Pico child seats manufactured between February 1, 2019, and August 23, 2019. The headrest's aluminum tubular frame can break allowing the headrest to detach.

**Remedy:** The manufacturer is still developing a plan to replace the headrests on the affected seats, free of charge. The recall began November 12, 2019. Owners may contact WAYB customer service at [help@wayb.com](mailto:help@wayb.com) or 1-888-924-9292.

**Notes:** Owners may also contact the National Highway Traffic Safety Administration Vehicle Safety Hotline at 1-888-327-4236 (TTY 1-800-424-9153) or go to [www.safercar.gov](http://www.safercar.gov).

## 4 MOMS

**December 30, 2016: NHTSA CAMPAIGN NUMBER: 16C009000 - Infant Carrier may not Secure to Base**

**Safety Risk:** If the infant carrier does not properly attach to the base, the carrier can detach in a crash, increasing the risk of injury.

**Manufacturer:** THORLEY INDUSTRIES D/B/A 4MOMS

**Potential Number of Units Affected:** 1,622

**Manufacture Dates:** July 1, 2016 - October 31, 2016

**Summary:** Thorley Industries LLC d/b/a 4moms (4moms) is recalling certain 4moms Self Installing Rear-facing Infant Car Seats, model number 1032, manufactured July 1, 2016, to October 31, 2016. Due to a tight rivet, the affected car seats have a coupling hook that may not properly engage around the coupling pin, preventing the infant carrier portion from securely attaching to the seat base.

**Remedy:** 4moms will notify owners and will replace the infant carrier portion, free of charge. The recall began on January 10, 2017. Owners may contact 4moms at 4moms.com/recalls or by calling 1-888-614-6667.

**Notes:** Owners may also contact the National Highway Traffic Safety Administration Vehicle Safety Hotline at 1-888-327-4236 (TTY 1-800-424-9153) or go to [www.safercar.gov](http://www.safercar.gov).