

Recall List (Updated 8/14/2026)

Baby Trend

May 4, 2023 NHTSA CAMPAIGN NUMBER: 23C004000 - Child Seat Webbing May Fail/FMVSS 213 & 209

Safety Risk: A child seat that fails to properly restrain a child increases the risk of injury in a crash.

Manufacturer: Baby Trend, Inc.

Potential Number of Units Affected: 2,600

Manufacture Dates: December 6, 2021

Summary: Baby Trend, Inc. (Baby Trend) is recalling certain Hybrid 3-in-1 Combination Booster Seat-Desert Blue child seats. The latch assembly webbing that secures the child restraint system to the lower anchorages may fray, which can reduce the strength of the webbing and fail to properly restrain a child in a crash. As such, these child seats fail to comply with the requirements of Federal Motor Vehicle Safety Standard numbers 213, "Child Restraint Systems," and 209, "Seat Belt Assemblies."

Remedy: Baby Trend, Inc. will mail owners a replacement latch assembly webbing and installation instructions, free of charge. Owner notification letters are expected to be mailed June 30, 2023. Owners may contact Baby Trend customer service at 1-800-328-7363.

Notes: Owners may also contact the National Highway Traffic Safety Administration Vehicle Safety Hotline at 1-888-327-4236 (TTY 1-800-424-9153), or go to www.nhtsa.gov.

December 19, 2016: NHTSA CAMPAIGN NUMBER: 16C008000 - Center Adjuster Rivet May Break/FMVSS 213

Safety Risk: In the event of a crash, the child seat occupant is at an increased risk of injury.

Manufacturer: Baby Trend, Inc.

Potential Number of Units Affected: 34

Manufacture Dates: Hybrid LX 3-in-1 Centennial: July 23, 2016 & Hybrid LX 3-in-1 Kiwi: July 14, 2016

Summary: Baby Trend, Inc. (Baby Trend) is recalling certain Hybrid LX 3-in-1 Centennial booster seats, model number FB58181, manufactured on July 23, 2016, and Hybrid LX 3-in-1 Kiwi booster seats, model number FB48417, manufactured on July 14, 2016. The affected child seats have a center adjuster rivet that may pull through or break if the harness is being used with a child weighing more than 40 lbs. As such, these child seats fail to comply with the requirements of Federal Motor Vehicle Safety Standard (FMVSS) number 213, "Child Restraint Systems."

Remedy: Baby Trend will notify owners and replace the child seat or provide a full refund. The recall began on February 13, 2017. Owners may contact Baby Trend customer service at 1-800-328-7363.

Notes: Owners may also contact the National Highway Traffic Safety Administration Vehicle Safety Hotline at 888-327-4236 (TTY 1-800-424-9153) or go to www.safercar.gov.

Britax Child Safety, Inc

August 20, 2026 NHTSA Campaign Number: 26C006000 – Child Seat Carrying Handle May Detach

Safety Risk: A child may fall after a partial detachment of the handle, increasing the risk of injury.

Manufacturer: Britax Child Safety, Inc.

Potential Number of Units Affected: 114,660

Manufacture Dates: August 17, 2020 – May 10, 2023

Summary: Britax Child Safety, Inc. (Britax) is recalling certain B-Safe Gen 2, B-Safe Gen 2 FlexFit, B-Safe Gen 2 FlexFit Plus, B-Safe 35, B-Safe Ultra, and Endeavours child seats. A screw in the child seat carrying handle may come loose, causing the handle to partially detach. Extended use and certain wear conditions may cause a screw in one side of the car seat's hub assembly to loosen. If this condition occurs, the carry handle may detach on one side, creating a fall hazard and potential risk of injury to the child. The handle condition is expected to be readily detectable by caregivers during normal use, as the handle may visibly separate and/or feel loose before any potential detachment.

Model Name	Model Number	Date of Manufacturer
B-SAFE 35	S12044800	September 08, 2020 - December 21, 2020
B-SAFE 35	S11880000	December 08, 2020 - December 08, 2020
B-SAFE 35	E1A728Y	August 17, 2020 - February 12, 2021
B-SAFE 35	S12045000	September 08, 2020 - December 19, 2020
B-SAFE 35	S12317300	January 05, 2021 - January 05, 2021
B-SAFE 35	S09385000	September 01, 2020 - November 06, 2020
B-SAFE 35	E1A729X	September 04, 2020 - February 10, 2021
B-SAFE 35	S11809200	October 03, 2020 - October 03, 2020
B-SAFE 35	S05588500	August 17, 2020 - February 17, 2021

B-SAFE 35	S12645500	August 26, 2020 - November 13, 2020
B-SAFE 35	E1A183D	August 26, 2020 - March 04, 2021
B-SAFE 35	S010144500	August 19, 2020 - February 01, 2021
B-SAFE 35	E1A728Z	August 29, 2020 - January 14, 2021
B-SAFE 35	E1A729R	August 17, 2020 - February 17, 2021
B-SAFE 35	E1C368Y	August 20, 2020 - December 21, 2020
B-SAFE 35	S11809100	August 17, 2020 - February 17, 2021
B-SAFE 35	S05587900	August 17, 2020 - January 05, 2021
B-SAFE 35	S05588400	September 01, 2020 - February 17, 2021
B-SAFE GEN 2	EXC772C	January 07, 2021 - February 02, 2021
B-SAFE GEN 2	S12776400	March 04, 2021 - October 28, 2022
B-SAFE GEN 2	S12652100	January 28, 2021 - April 07, 2021
B-SAFE GEN 2	S12776300	January 29, 2021 - March 30, 2023
B-SAFE GEN 2	S12776200	February 08, 2021 - October 25, 2022
B-SAFE GEN 2	E1C732L	February 08, 2021 - March 29, 2023
B-SAFE GEN 2	S12776100	March 04, 2021 - March 07, 2022
B-SAFE GEN 2	S12778600	February 08, 2021 - September 20, 2022
B-SAFE GEN 2	E1C732J	March 11, 2021 - February 07, 2023
B-SAFE GEN 2	E1C772C	December 28, 2020 - May 26, 2022
B-SAFE GEN 2	E1C732C	February 02, 2021 - May 11, 2023
B-SAFE GEN 2	S12652000	December 17, 2020 - May 17, 2022
B-SAFE GEN 2	E1C802C	February 09, 2021 - Jun 02, 2022
B-SAFE GEN 2	S12778700	February 08, 2021 - May 16, 2023
B-SAFE GEN2 FLEXFIT	S12777300	February 15, 2021 - February 06, 2023
B-SAFE GEN2 FLEXFIT	S12777200	February 15, 2021 - November 02, 2022
B-SAFE GEN2 FLEXFIT	S12777000	February 25, 2021 - February 08, 2022
B-SAFE GEN2 FLEXFIT	S12776800	
B-SAFE GEN2 FLEXFIT	S12776700	February 15, 2021 - October 24, 2022
B-SAFE GEN2 FLEXFIT	E1C749S	February 25, 2021 - April 18, 2023
B-SAFE GEN2 FLEXFIT	E1C746B	January 20, 2021 - April 25, 2023
B-SAFE GEN2 FLEXFIT	E1C742G	December 28, 2020 - January 24, 2023
B-SAFE GEN2 FLEXFIT	E1C741Q	February 15, 2021 - February 28, 2023
B-SAFE GEN2 FLEXFIT PLUS	S12778100	February 16, 2021 - November 08, 2022
B-SAFE GEN2 FLEXFIT PLUS	S12777800	February 16, 2021 - May 10, 2023
B-SAFE GEN2 FLEXFIT PLUS	S12777600	February 16, 2021 - October 18, 2022
B-SAFE GEN2 FLEXFIT PLUS	E1C769V	
B-SAFE GEN2 FLEXFIT PLUS	E1C767T	December 28, 2020 - Sep 27, 2022
B-SAFE GEN2 FLEXFIT PLUS	E1C767N	February 15, 2021 - Sep 27, 2022
B-SAFE ULTRA	S11771800	August 31, 2020 - March 04, 2021
B-SAFE ULTRA	E1C009S	August 27, 2020 - February 05, 2021
B-SAFE ULTRA	E1C001Q	August 17, 2020 - February 11, 2021
B-SAFE ULTRA	S10888400	September 04, 2020 - November 07, 2020
B-SAFE ULTRA	S09828600	September 16, 2020 - October 10, 2020
B-SAFE ULTRA	S11251600	August 27, 2020 - February 03, 2021
B-SAFE ULTRA	E1C438M	August 27, 2020 - October 30, 2020
B-SAFE ULTRA	E1C008M	August 17, 2020 - March 04, 2021

B-SAFE ULTRA	S11747200	September 23, 2020 - February 18, 2021
B-SAFE ULTRA	E1C008N	September 03, 2020 - March 04, 2021
B-SAFE ULTRA	E1C009T	September 09, 2020 - February 05, 2021
B-SAFE ULTRA	S11747400	August 19, 2020 - February 18, 2021
B-SAFE ULTRA	S10888700	August 18, 2020 - August 18, 2020
B-SAFE ULTRA	S05588200	August 18, 2020 - February 04, 2021
B-SAFE ULTRA	S05588100	August 18, 2020 - February 04, 2021
B-SAFE ULTRA	S11747300	September 23, 2020 - September 23, 2020
B-SAFE ULTRA	E1C009E	September 08, 2020 - February 11, 2021
B-SAFE ULTRA	E1C002G	August 17, 2020 - February 18, 2021
ENDEAVOURS	S12399800	August 24, 2020 - December 17, 2020
ENDEAVOURS	E1A539E	August 17, 2020 - March 04, 2021
ENDEAVOURS	S12034400	August 17, 2020 - November 20, 2020
ENDEAVOURS	E1A539L	August 17, 2020 - February 10, 2021
ENDEAVOURS	S11747900	September 02, 2020 - February 03, 2021
ENDEAVOURS	E1A535Q	August 17, 2020 - March 04, 2021
ENDEAVOURS	E1A537U	August 17, 2020 - January 08, 2021
ENDEAVOURS	S11771200	August 24, 2020 - December 22, 2020
ENDEAVOURS	E1A909V	November 23, 2020 - December 11, 2020

Remedy: The remedy is currently under development. Owner notification letters are expected to be mailed by October 19, 2026. Owners may contact Britax customer service at 888-427-4829. Affected products are no longer in production.

Notes: Owners may also contact the National Highway Traffic Safety Administration Vehicle Safety Hotline at 1-888-327-4236 (TTY 1-800-424-9153) or go to www.nhtsa.gov.

November 19, 2024 NHTSA Campaign Number: 24C001000 - Incorrect Maximum Weight on Labels/ FMVSS 213

Safety Risk: An incorrect label and user guide may result in an improperly installed child seat, increasing the risk of injury in a crash.

Manufacturer: Britax Child Safety, Inc.

Potential Number of Units Affected: 1,286

Manufacture Dates: July 10, 2024 – July 15, 2024

Summary: Britax Child Safety, Inc. (Britax) is recalling certain One4Life Slim ClickTight All-in-One car seats with model numbers E1D197A, E1D197B, E1D197F, and E1D197G. The labels and user guide incorrectly state the maximum rear-facing lower anchor weight. As such, these child seats fail to comply with the requirements of Federal Motor Vehicle Safety Standard number 213, "Child Restraint Systems." The One4Life Slim labels and user guide incorrectly listed 40 lbs. as the maximum rear-facing lower anchor weight. Instead, the maximum rear-facing lower anchor weight should be 35 lbs. in accordance with S5.5.2(l)(3)(i)(C) of FMVSS No. 213. If the One4Life Slim is installed rear-facing using lower connectors with a child weighing over 35 lbs., it may not adequately protect the child from injury in the event of a crash.

Remedy: Britax will provide all owners of the One4Life Slim car seat models E1D197A, E1D197B, E1D197F and E1D197G a remedy kit, free of charge. The remedy kit will include a label to be inserted to correct the user guide, replacement labels to be placed over the original on-product labels, and an instruction sheet for application of the remedy labels. Owner notification letters are expected to be mailed December 18, 2024. Owners may contact Britax customer service at 888-427-4829.

Notes: Owners may also contact the National Highway Traffic Safety Administration Vehicle Safety Hotline at 1-888-327-4236 (TTY 1-800-424-9153) or go to www.nhtsa.gov.

June 15, 2017: NHTSA CAMPAIGN NUMBER: 17C002000 - Chest Clip Tab may Break and be a Choking Hazard

Safety Risk: The broken tab may present a choking hazard to an infant in the car seat, increasing the risk of injury.

Manufacturer: Britax Child Safety, Inc.

Potential Number of Units Affected: 207,037

Manufacture Dates: November 11, 2015 – May 31, 2017

Summary: Britax Child Safety, Inc. (Britax) is recalling certain B-Safe 35, B-Safe 35 Travel Systems, B-Safe 35 Elite, BSafe 35 Elite Travel Systems and BOB B-Safe rear-facing infant child safety seats, model numbers E1A183F, E1A185M, E1A185P, E1A186R, E1A203F, E1A205M, E1A205P, E1A206X, E1A206Z, E1A207E, E9LU65V, E9LU66X, E9LU66Z, E9LU67D, E9LU67E, EXA185M, S02063600, S02063700, S03803400, S03803500, S03803700, S03803800, S03803900,

S04144400, S04144500, S04144600, S04145000, S04402800, S04884200, S04884300, S04975600, S04978900, S05260200, S06020300, S06020400, S06020500, S06020600, S06020700, S06020800, S06020900, S06147100, S921800, E1A215T, E1A215U, E1A216P, E1A221Q, E1A225C, E1A225U, E1A226L, E9LS51Q, E9LS56C, E9LS56L, E9LS57F, E9LS57G, E9LS57H, EXA216L, S01298600, S02063800, S02063900, S02064000, S04281200, S04281300, S04628500, S06018800, S06020000, S06020200, S923700, E9LT34A, E9LT34C, E9LT35X and EXLT34A. The affected child safety seats have a center tab on the chest clip marked "ABS" that may break.

Remedy: Britax will notify owners and will provide a replacement chest clip marked "PC", free of charge. The recall began on June 21, 2017. Owners may contact Britax at 1-833-474-7016 or visit www.bsafec35clip.com.

Notes: Owners may also contact the National Highway Traffic Safety Administration Vehicle Safety Hotline at 1-888-327-4236 (TTY 1-800-424-9153) or go to www.safercar.gov.

Chicco USA, Inc

March 27, 2025 NHTSA CAMPAIGN NUMBER: 25C005000 - Child Seat May Allow Excessive Movement

Safety Risk: A child seat that fails to properly restrain a child increases the risk of injury in a crash.

Manufacturer: Chicco USA, Inc.

Potential Number of Units Affected: 30,984

Manufacture Dates: September 1, 2020 - August 31, 2024

Summary: Chicco USA, Inc. (Chicco) is recalling certain MyFit Zip Air Harness and Booster child restraint seats (CRS) with model numbers 07079561970070 and 04079561190070. In certain configurations, the child seat may allow excessive chest movement in a crash. As such, these child seats fail to comply with the requirements of Federal Motor Vehicle Safety Standard number 213, "Child Restraint Systems."

Remedy: The remedy is currently under development. Artsana USA, Inc, is currently exploring potential remedies including amended instructions including recline positions. Note: The MyFit Zip Air is no longer being manufactured as of August 2024. The manufacturer has not provided a schedule for recall notification. Owners may contact Chicco's customer service at 1-877-424-4226.

Notes: Owners may also contact the National Highway Traffic Safety Administration Vehicle Safety Hotline at 888-327-4236 (TTY 888-275-9171) or go to nhtsa.gov.

Clek, Inc

June 7, 2022: NHTSA CAMPAIGN NUMBER: 22C002000 - Installation Diagram Missing/FMVSS 213

Safety Risk: A missing installation label may result in an improperly installed child seat, increasing the risk of injury in a crash.

Manufacturer: Clek, Inc.

Potential Number of Units Affected: 11,123

Manufacture Dates: Olli: January 20, 2020 – May 10, 2022 & Ozzi: March 1, 2020 – May 10, 2022

Summary: Clek, Inc. (Clek) is recalling certain Olli booster seats, model number OL12U2 manufactured between January 20, 2020 and May 10, 2022, and Ozzi booster seats model number OZ11U2, manufactured between March 1, 2020 and May 10, 2022. The installation diagram displaying the proper way to install the booster seat with a continuous-loop lap/shoulder belt is missing. As such, these child seats fail to comply with the requirements of Federal Motor Vehicle Safety Standard number 213, "Child Restraint Systems."

Remedy: Clek will mail owners a new label, free of charge. Owner notification letters are expected to be mailed, beginning July 25, 2022. Owners may contact Clek's customer service by email at olliozzilabel@clekinc.com or by telephone at 1-866-656-2462.

Notes: Owners may also contact the National Highway Traffic Safety Administration Vehicle Safety Hotline at 1-888-327-4236 (TTY 1-800-424-9153) or go to www.nhtsa.gov.

December 20, 2021 NHTSA CAMPAIGN NUMBER: 21C007000-Label Can Come Apart and May Pose Choking Hazard

Safety Risk: Detached pieces of the labels can present a choking hazard to a child, increasing the risk of injury.

Manufacturer: Clek, Inc.

Potential Number of Units Affected: 596

Manufacture Dates: Liing: March 27, 2019 – September 14, 2020; Liingo: May 5, 2020 – September 14, 2020

Summary: Clek, Inc. (Clek) is recalling certain Liing, model LG19U1, and Liingo, model number LGO20U1, infant child seats manufactured before February 22, 2021. The labels on the seat cover or infant insert may bubble up, allowing the labels to come apart into small pieces.

Remedy: Clek will provide a replacement seat cover or infant insert, free of charge. Owner notification letters were mailed January 31, 2022. Owners may contact Clek customer service at 1-866-656-2462.

Notes: Owners may also contact the National Highway Traffic Safety Administration Vehicle Safety Hotline at 1-888-327-4236 (TTY 1-800-424-9153), or go to www.nhtsa.gov.

December 1, 2021: NHTSA CAMPAIGN NUMBER: 21C005000 - Loose Foam in Child Seat May Become Choking Hazard

Safety Risk: Loose pieces of foam can present a choking hazard to a child, increasing the risk of injury.

Manufacturer: Clek, Inc.

Potential Number of Units Affected: 150,599

Manufacture Dates: December 3, 2012 – May 20, 2021

Summary: Clek, Inc. (Clek) is recalling certain Foonf, model numbers FO12 through FO19, and Fllo, model numbers FL15 through FL19, convertible child seats manufactured prior to May 21, 2021. A child may pick pieces of foam from the foam cushion located under the seat pad.

Remedy: Clek will provide a molded plastic insert that prevents access to the foam, along with instructions on how to attach it to the child seat, free of charge. Owner notification letters were mailed January 28, 2022. Owners may contact Clek customer service at 1-866-656-2462.

Notes: Owners may also contact the National Highway Traffic Safety Administration Vehicle Safety Hotline at 1-888-327-4236 (TTY 1-800-424-9153) or go to www.nhtsa.gov.

December 1, 2021: NHTSA CAMPAIGN NUMBER: 21C006000 - Child Seat Canopy Support May Pose Choking Hazard

Safety Risk: A detached piece of plastic can present a choking hazard to a child, increasing the risk of injury.

Manufacturer: Clek, Inc.

Potential Number of Units Affected: 5,504

Manufacture Dates: March 27, 2019 – September 14, 2020

Summary: Clek, Inc. (Clek) is recalling certain Liing, model number LG19U1, and Liingo, model number LGO20U1, infant child seats manufactured before September 15, 2020. A small plastic portion of the child seat canopy support may break and detach from the seat.

Remedy: Clek will provide a replacement canopy support along with instructions on how to replace it, free of charge. Owner notification letters were mailed January 31, 2022. Owners may contact Clek customer service at 1-866-656-2462.

Notes: Owners may also contact the National Highway Traffic Safety Administration Vehicle Safety Hotline at 1-888-327-4236 (TTY 1-800-424-9153) or go to www.nhtsa.gov.

Combi USA, Inc

March 8, 2021: NHTSA CAMPAIGN NUMBER: 21C001000 - Child Seat Webbing May Fail/FMVSS 213

Safety Risk: A child that is not adequately restrained in a crash has an increased risk of injury.

Manufacturer: Combi USA, Inc.

Potential Number of Units Affected: 13,880

Manufacture Dates: May 1, 2016 – August 31, 2019

Summary: Combi USA, Inc. (Combi) is recalling certain Combi BabyRide Infant Car Seats, model 378099 with dates of manufacture of 5/1/2016 thru 8/31/2019. The 1-inch-wide webbing strap used in the center front adjuster to adjust the shoulder harness straps fail the minimum initial breaking strength requirements, and in certain circumstances, may not adequately restrain a child during a crash. As such, these car seats fail to conform to Federal Motor Vehicle Safety Standard (FMVSS) number 213, "Child Restraint Systems."

Remedy: Combi will provide owners a replacement strap along with instructions for replacement. Owner notifications letters were mailed Jan. 28, 2022. Owners may contact Combi customer service by emailing customerservice@combiusa.com.

Notes: Owners may also contact the National Highway Traffic Safety Administration Vehicle Safety Hotline at 1-888-327-4236 (TTY 1-800-424-9153) or go to www.nhtsa.gov.

Cybex

February 14, 2025: NHTSA CAMPAIGN NUMBER: 25C002000 - Harness Strap May Detach From Seat

Safety Risk: A detached harness will not properly restrain a child, increasing the risk of injury.

Manufacturer: Columbus Trading-Partners USA, Inc.

Potential Number of Units Affected: 22,823

Manufacture Dates: March 10, 2023 - May 10, 2024

Summary: Columbus Trading-Partners USA, Inc. (CTP) is recalling certain Cybex Aton G, Aton G SensorSafe, Aton G Swivel, Aton G Swivel SensorSafe, Eos and Aton G Swivel Travel System, and Eos and Aton G Travel System child seats. The harness hip anchorage retention hooks may bend, causing the anchor pin to loosen, and the harness strap to detach.

Remedy: CTP will mail owners a remedy kit and installation instructions, free of charge. Owner notification letters are expected to be mailed April 4, 2025. Owners may contact CTP customer service at 877-242-5676.

Notes: Owners may also contact the National Highway Traffic Safety Administration Vehicle Safety Hotline at 888-327-4236 (TTY 888-275-9171) or go to nhtsa.gov.

February 10, 2023 NHTSA CAMPAIGN NUMBER: 23C001000 - Infant Seat Webbing May Fail/FMVSS 213 & 209

Safety Risk: An infant seat belt with insufficient strength may not properly restrain the occupant, increasing the risk of injury in a crash. The 1-inch-wide webbing used in the central front adjuster does not have a breaking strength of not less than 75 percent of the new webbing strength when tested in accordance with S5.1(b) of FMVSS No. 209.

Manufacturer Columbus Trading-Partners USA, Inc.

Potential Number of Units Affected 31,080

Manufacture Dates: Cybex Aton: March 29, 2017 – January 4, 2020

Cybex Aton Q: March 13, 2017 – January 3, 2020

Cybex Aton M: March 7, 2018 – November 1, 2020

Cybex Aton 2: March 29, 2017 – October 27, 2020

Cybex Cloud Q: July 6, 2017 – October 20, 2020

Summary: Columbus Trading-Partners USA, Inc. (CTP) is recalling certain Cybex models Aton, Aton Q, Aton M, Aton 2, and Cloud Q rear facing infant seats. Please refer to CTP's recall report for specific model details. The design of the webbing for the central seat belt adjuster allows it to fray, which can reduce the strength of the seat belt. As such, these infant seats fail to comply with the requirements of Federal Motor Vehicle Safety Standard numbers 213, "Child Restraint Systems" and 209, "Seatbelt Assemblies."

CTP/CYBEX has determined that the 1-inch-wide webbing strap used in the center front adjuster to snugly adjust the shoulder harness straps onto the child does not meet the retained strength requirements after hex bar abrasion as specified in FMVSS No. 213, S5.4.1.2(b)(1). If the adjuster webbing becomes frayed or worn, which can reduce the strength of the webbing, the webbing could fail to properly restrain the occupant in the event of a vehicle crash increasing the occupant's risk of injury.

Remedy: CTP/CYBEX will mail owners a replacement central seat belt adjuster strap assembly and installation instructions, free of charge. Owner notification letters are expected to be mailed March 13, 2023. Owners may contact CTP's customer service at 1-937-415-3215.

Notes: Owners may also contact the National Highway Traffic Safety Administration Vehicle Safety Hotline at 1-888-327-4236 (TTY 1-800-424-9153) or go to www.nhtsa.gov.

April 8, 2022: NHTSA CAMPAIGN NUMBER: 22C001000 - Choking Hazard from Foam in Child Seat Headrest

Safety Risk: Loose pieces of foam can present a choking hazard to a child, increasing the risk of injury.

Manufacturer: Columbus Trading-Partners USA, Inc.

Potential Number of Units Affected: 20,526

Manufacture Dates: November 3, 2017 - August 31, 2018

Summary: Columbus Trading-Partners USA, Inc. (CTP) is recalling certain CYBEX Sirona M Convertible Child Car Seat, model numbers 518000385, 518002153, 518000387, 518002145, 518002149, 518002151, and 519000211, manufactured between November 3, 2017, and August 31, 2018. A child may pick pieces of foam from the child seat headrest pad.

Remedy: CTP will mail a kit with instructions on how to seal the headrest foam, free of charge. Owner notification letters were mailed May 23, 2022. Owners may contact CTP customer service at 1-877-242-5676.

Notes: Owners may also contact the National Highway Traffic Safety Administration Vehicle Safety Hotline at 1-888-327-4236 (TTY 1-800-424-9153) or go to www.nhtsa.gov.

Diono

March 24, 2021: NHTSA CAMPAIGN NUMBER: 21C002000 - Headrest May Break or Separate/FMVSS 213

Safety Risk: A broken or separated headrest increases the risk of injury during a crash.

Manufacturer: Diono

Potential Number of Units Affected: 6,920

Manufacture Dates: September 5, 2020 – November 30, 2020

Summary: Diono is recalling certain Cambria 2 Booster Seats, model numbers 31200-US-01, 31201-US-01, and 31202-US-01. In the event of a crash, a crack between the headrest and backrest can occur, allowing the headrest to separate. As such, these seats fail to comply with the requirements of Federal Motor Vehicle Safety Standard number 213, "Child Restraint Systems."

Remedy: Diono will provide a replacement backrest with headrest assembly, free of charge. Diono recommends converting the seat into a backless booster seat until the replacement backrest is installed. Owner notification letters were mailed on May 24, 2021. Owners may contact Diono customer service at 1-855-463-4666.

Notes: Owners may also contact the National Highway Traffic Safety Administration Vehicle Safety Hotline at 1-888-327-4236 (TTY 1-800-424-9153) or go to www.safercar.gov.

September 14, 2017: NHTSA CAMPAIGN NUMBER: 17C003000 - Injury Risk when Seat used with Lap Belt/FMVSS 213

Safety Risk: If the seat is installed with only the lap belt, the child has an increased risk of a chest injury in the event of a crash.

Manufacturer: Diono (formerly SUNSHINE KIDS JUVENILE)

Potential Number of Units Affected: 519,052

Manufacture Dates: November 25, 2013 - September 5, 2017

Summary: Diono is recalling certain Radian R100, Radian R120, Radian RXT, Olympia, Pacifica, and Rainier convertible and booster car seats. When the seat is installed in the forward-facing position and secured to the car using the lap belt without also using the top tether, the seat may not adequately protect the child from injury in the event of a crash. As such, these child seats fail to conform to the requirements of Federal Motor Vehicle Safety Standard (FMVSS) number 213, "Child Restraint Systems." Only seats manufactured between November 25, 2013, and September 5, 2017, are affected by this recall campaign.

Remedy: Diono will notify owners and provide a free remedy kit with an updated instruction manual, energy absorbing pad, as well as a new chest clip, free of charge. The recall began on November 22, 2017. Owners may contact Diono customer service at 1-855-215-4951.

Notes: Owners may also contact the National Highway Traffic Safety Administration Vehicle Safety Hotline at 1-888-327-4236 (TTY 1-800-424-9153) or go to www.safercar.gov.

Dorel Juvenile Group

April 18, 2025: NHTSA CAMPAIGN NUMBER: 25C006000 - Choking Hazard from Foam in Child Seat Headrest

Safety Risk: Pieces of foam can present a choking hazard to a child, increasing the risk of injury.

Manufacturer: Dorel Juvenile Group

Potential Number of Units Affected: 179,845

Manufacture Dates: February 28, 2023 – December 31, 2023

Summary: Dorel Juvenile Group (Dorel) is recalling certain Safety 1st Grow & Go Sprint child seats. The included model numbers are CC321GYU, CC321GYUD, CC321GYY, CC321GYYD, CC321HAO, and CC321HAR. The headrest foam pad is not adequately secured, which can allow a child to pick off pieces of foam.

Remedy: Dorel will mail a replacement headrest pad assembly kit, free of charge. Owner notification letters are expected to be mailed June 9, 2025. Owners may contact Dorel's customer service at 1-877-657-9546 or gng-sprint-recall@djgusa.com.

Notes: Owners may also contact the National Highway Traffic Safety Administration Vehicle Safety Hotline at 888-327-4236 (TTY 888-275-9171) or go to nhtsa.gov.

March 12, 2025: NHTSA CAMPAIGN NUMBER: 25C004000 - Incorrect Height Range on Label/FMVSS 213

Safety Risk: An incorrect label may result in an improperly restrained child, increasing the risk of injury in a crash.

Manufacturer: Dorel Juvenile Group

Potential Number of Units Affected: 73,144

Manufacture Dates: February 28, 2023 – March 7, 2025: Comfort Ride 3-in-1 Harness Booster

May 30, 2023 - March 7, 2025: Boost & Go 3-in-1 Harness Booster

July 17, 2023 - March 7, 2025: MagicSquad 3-in-1 Harness Booster

January 29, 2024 - March 7, 2025: Boost & Go Essential 3-in-1 Harness Booster

Summary: Dorel Juvenile Group (Dorel) is recalling certain Safety 1st Comfort Ride 3-in-1, Boost & Go 3-in-1, Boost & Go Essential 3-in-1, and MagicSquad 3-in-1 harness booster child seats.

Model Numbers:

- Safety 1st Comfort Ride 3-in-1 Harness Booster: BC159GKO, BC159HAA, BC159HBE, BC159HBED, BC159HBH
- Safety 1st Boost & Go 3-in-1 Harness Booster: BC163HAS, BC163HAY
- Disney Baby MagicSquad 3-in-1 Harness Booster: BC167GNT, BC167GNU
- Safety 1st Boost & Go Essential 3-in-1 Harness Booster: BC181HFW, BC181HFWD, BC181HGW

The forward-facing installation label incorrectly states the height range. As such, these child seats fail to comply with the requirements of Federal Motor Vehicle Safety Standard number 213, "Child Restraint Systems."

Remedy: Dorel will mail owners a new label, free of charge. The manufacturer has not yet provided a schedule for recall notification. Owners may contact Dorel's customer service at 1-877-657-9546 or comfort-ride-recall@djgusa.com.

Notes: Owners may also contact the National Highway Traffic Safety Administration Vehicle Safety Hotline at 888-327-4236 (TTY 888-275-9171) or go to nhtsa.gov.

March 14, 2023 NHTSA CAMPAIGN NUMBER: 23C003000 - Insufficient Child Seat Inner Carrier/FMVSS 213

Safety Risk: In the event of a crash, an insufficiently restrained child has an increased risk of injury.

Manufacturer Dorel Juvenile Group

Potential Number of Units Affected 14,510

Model Number / Manufacture Dates: Maxi-Cosi Coral XP: IC313 / May 1, 2020 – February 28, 2023-All products

Summary: Dorel Juvenile Group (Dorel) is recalling certain Maxi-Cosi Coral XP Rear-facing Infant Seats with model number IC313. The child seat inner carrier is not sufficient to restrain a child without the use of the outer carrier. As such, these child seats fail to comply with the requirements of Federal Motor Vehicle Safety Standard number 213, "Child Restraint Systems."

Remedy: Owners are advised to only use the inner carrier of the Coral XP when it is attached to the outer carrier and installed with or without the base using the vehicle belt restraint system, consistent with the existing instruction booklet and labels. Dorel will offer a refund or replace the child seat, free of charge. Owner notification letters are expected to be mailed April 7, 2023. Owners may contact Dorel's customer service at 1-877-657-9546 or CoralXPRecall@djgusa.com.

Notes: Owners may also contact the National Highway Traffic Safety Administration Vehicle Safety Hotline at 1-888-327-4236 (TTY 1-800-424-9153) or go to www.nhtsa.gov.

March 3, 2023 NHTSA CAMPAIGN NUMBER: 23C002000 - Child Seat Lower Anchor Failure/FMVSS 213

Safety Risk: A detached child seat may not properly restrain the occupant, increasing the risk of injury in a crash.

Manufacturer Dorel Juvenile Group

Potential Number of Units Affected 59,450

Model Number / Manufacture Dates:

- Maxi-Cosi Coral XP: IC313 / May 1, 2020 - February 28, 2023
- Maxi-Cosi Infant Base: IC335 / May 1, 2020 - February 28, 2023
- Maxi-Cosi Mico Luxe+: IC370 / January 1, 2022 - February 28, 2023
- Maxi-Cosi Mico XP: IC336 and IC338 September 1, 2020 - February 28, 2023
- Maxi-Cosi Mico XP Max: IC337 / January 1, 2021 - February 28, 2023
- Safety 1st OnBoard 35 SecureTech: IC351 / May 1, 2022 - February 28, 2023

Summary: Dorel Juvenile Group (Dorel) is recalling certain Safety 1st onBoard 35 Secure Tech, Maxi-Cosi Coral XP, Maxi-Cosi Mico XP Max, Maxi-Cosi Mico XP, Maxi-Cosi Mico Luxe+, and Maxi-Cosi Infant Base child seats. Please refer to Dorel's recall report for specific model numbers. The lower seat anchors used to secure the child seat base may fail, allowing the child seat to detach. As such, these child seats fail to comply with the requirements of Federal Motor Vehicle Safety Standard number 213, "Child Restraint Systems." Dorel has received no reports of injuries related to this noncompliance.

Remedy: Owners may continue to use their car seat with the base or with the shell only when secured using the vehicle seat belt consistent with the existing instructions in the manual and labels. A free replacement base will be sent to the owners once available. Owners are advised to only secure their child seat(s) with the vehicle belt restraint system until the seat is remedied.

Owner notification letters are expected to be mailed April 7, 2023. Owners may contact Dorel customer service at 1-877-657-9546 or RetractableLatchRecall@djgusa.com.

Notes: Owners may also contact the National Highway Traffic Safety Administration Vehicle Safety Hotline at 1-888-327-4236 (TTY 1-800-424-9153), or go to www.nhtsa.gov.

September 8, 2021: NHTSA CAMPAIGN NUMBER: 21C004000 - Potential Head Injury With Lap Belt Use/ FMVSS 213

Safety Risk: If the seat is installed with only the lap belt, the child has an increased risk of injury in the event of a crash.

Manufacturer: Dorel Juvenile Group

Potential Number of Units Affected: 4,000

Manufacture Dates: January 1, 2019 - July 31, 2019

Summary: Dorel Juvenile Group (Dorel) is recalling certain Maxi-Cosi Pria 70 Convertible child seats. When the seat is installed in the forward-facing position and secured to the car using the lap belt without also using the top tether, the seat may not adequately protect the child from head injury in the event of a crash. As such, these child seats fail to conform to the requirements of Federal Motor Vehicle Safety Standard (FMVSS) number 213, "Child Restraint Systems."

Remedy: Dorel will provide remedy kits containing replacement labels and instruction booklets. The new instruction booklet and replacement labels will reduce the forward-facing internal harness weight to 65 pounds and 49 inches in height. If you were intending to use the car seat for a child that weighs more than 65 pounds or taller than 49 inches, Dorel will provide, at no charge, the Maxi-Cosi Rodi Sport Booster seats rated for children 40-100 pounds and 43 to 57 inches in height. Owner notification letters were issued beginning October 12, 2021. Owners may contact Dorel customer service at 1-877-657-9546 or by email at Pria85recall@djgusa.com.

Notes: Owners may also contact the National Highway Traffic Safety Administration Vehicle Safety Hotline at 1-888-327-4236 (TTY 1-800-424-9153) or go to www.nhtsa.gov.

August 24, 2021: NHTSA CAMPAIGN NUMBER: 21C003000 - Potential Head Injury with Lap Belt use/FMVSS 213

Safety Risk: If the seat is installed with only the lap belt, the child has an increased risk of injury in the event of a crash.

Manufacturer: Dorel Juvenile Group **Potential Number of Units Affected:** 119,863

Manufacture Dates: January 1, 2019 – August 17, 2021

Summary: Dorel Juvenile Group (Dorel) is recalling certain Maxi-Cosi Pria 85 Convertible child seats. When the seat is installed in the forward-facing position and secured to the car using the lap belt without also using the top tether, the seat may not adequately protect the child from head injury in the event of a crash. As such, these child seats fail to conform to the requirements of Federal Motor Vehicle Safety Standard (FMVSS) number 213, "Child Restraint Systems."

Remedy: Dorel will provide remedy kits containing replacement labels and instruction booklets. The new instruction booklet and replacement labels will reduce the forward-facing internal harness weight to 65 pounds and 49 inches in height. If you were intending to use the car seat for a child that weighs more than 65 pounds or taller than 49 inches, Dorel will provide, at no charge, the Maxi-Cosi Rodi Sport Booster seats rated for children 40-100 pounds and 43 to 57 inches in height. Owner notification letters were issued beginning October 12, 2021. Owners may contact Dorel customer service at 1-877-657-9546 or by email at Pria85recall@djgusa.com.

Notes: Owners may also contact the National Highway Traffic Safety Administration Vehicle Safety Hotline at 1-888-327-4236 (TTY 1-800-424-9153) or go to www.nhtsa.gov.

Dorel China America, Inc

October 17, 2019: NHTSA CAMPAIGN NUMBER: 19C002000 - Improper Warning Labels/FMVSS 213

Safety Risk: Without the safety warnings and instructions, caregivers may not know the risks or how to properly use the child seat, increasing the risk of an injury in the event of a crash.

Manufacturer: Dorel China America, Inc.

Potential Number of Units Affected: 28,800

Manufacture Dates: February 28, 2019 – February 28, 2019

Summary: Dorel China America, Inc. (DCA) is recalling certain Babidéal Storm Booster Car Seats, model BC901BPXL, sold exclusively at Family Dollar Stores. The label attached to the fabric cover may not have the required safety warnings and instructions. As such, these child seats fail to comply with the requirements of Federal Motor Vehicle Safety Standard (FMVSS) number 213, "Child Restraint Systems."

Remedy: DCA will notify the registered owners and will provide a replacement fabric cover that has a compliant warning label in place, free of charge. The recall began December 9, 2019. Owners may contact DCA customer service at 1-877-657-9546 or text 1-812-373-6673.

Notes: Owners may also contact the National Highway Traffic Safety Administration Vehicle Safety Hotline at 1-888-327-4236 (TTY 1-800-424-9153) or go to www.safercar.gov.

Evenflo

August 6, 2026 NHTSA Campaign Number: 26C005000

Incorrect Indicator for Recline Position

Safety Risk: A child seat that is not reclined as intended increases the risk of injury in a crash.

Manufacturer: Evenflo Company, Inc.

Potential Number of Units Affected: 22,981

Summary: Evenflo Company, Inc. (Evenflo) is recalling certain Revolve180 Litemax NXT child seats manufactured through March 31, 2025. Due to a miscalibrated level indicator, following the installation instructions can result in a child sitting more upright than intended. A caregiver might observe that a child is more upright than anticipated. Otherwise, the condition is not apparent. As such, these child seats fail to comply with the requirements of Federal Motor Vehicle Safety Standard number 213, "Child Restraint Systems."

Model Numbers:

Model Name	Model Number	Date of Manufacturer
Revolve180 Litemax NXT - Quartz Gray	CS160422545	March 17, 2025 - March 31, 2025
Revolve180 Litemax NXT - Agate Purple	CS160412546	January 09, 2025 - March 31, 2025
Revolve180 Litemax NXT - Quartz Gray	CS160412545	February 18, 2025 - February 28, 2025
Revolve180 Litemax NXT - Beau Navy	CS160412544	March 04, 2025 - March 31, 2025
Revolve180 Litemax NXT - Jasper Black	CS160412534	February 19, 2025 - March 29, 2025
Revolve180 Litemax NXT - Primrose Pink	CS160412532	March 21, 2025 - March 28, 2025
Revolve180 Litemax NXT - Rose Pink	CS160412520	March 04, 2025 - March 31, 2025
Revolve180 Litemax NXT - Cinder Gray	CS160412519	January 23, 2025 - March 31, 2025
Revolve280 Litemax NXT - Anchor Gray	CS160412531	January 20, 2025 - March 31, 2025

Revolve180 Litemax NXT Rotating Base	CS900610000	February 19, 2025 – March 31, 2025
Omni Ultra Travel System w/ Revolve180 Litemax NXT - Caviar Black	TS160112511	January 07, 2025 – March 31, 2025
Omni Ultra Travel System w/ Revolve180 Litemax NXT - Pacific Green	TS160112514	December 26, 2024 – March 31, 2025
Shyft Intuiti Travel System w/ Revolve180 Litemax NXT - Travertine	TS100212547	January 04, 2025 – March 31, 2025
Shyft Intuiti Travel System w/ Revolve180 Litemax NXT - Fossil Gray	TS100212542	January 03, 2025 – March 31, 2025
Shyft Intuiti Travel System w/ Revolve180 Litemax NXT - Amaranth Pink	TS100212541	January 06, 2025 – March 26, 2025
Shyft Intuiti Travel System w/ Revolve180 Litemax NXT - Angler Tweed	TS100212540	December 27, 2024 - March 31, 2025
Shyft Intuiti Travel System w/ Revolve180 Litemax NXT - Flint	TS100212533	March 17, 2025 - March 29, 2025
Shyft Intuiti Travel System w/ Revolve180 Litemax NXT - Black Shale	TS100212513	December 28, 2024 - March 31, 2025
Shyft Intuiti Travel System w/ Revolve180 Litemax NXT - Dubhan Black	TS100212512	January 04, 2025 - March 31, 2025
Shyft Intuiti Travel System w/ Revolve180 Litemax NXT - Champagne	TS100212506	March 19, 2025 - March 31, 2025

Remedy: The remedy for this recall is currently under development. Interim letters, notifying owners of the safety risk, are expected to be mailed beginning September 1, 2026. Additional letters will be sent once the remedy is available. Owners may contact Evenflo customer service at 1-800-233-5921.

Notes: Owners may also contact the National Highway Traffic Safety Administration Vehicle Safety Hotline at 1-888-327-4236 (TTY 1-888-275-9171), or go to www.nhtsa.gov.

July 17, 2026 NHTSA Campaign Number: 26C004000

Headrest Position May Shift in a Crash

Safety Risk: A headrest that shifts unexpectedly may increase the risk of injury in a crash.

Manufacturer: Evenflo Company, Inc.

Potential Number of Units Affected: 59,661

Summary: Evenflo Company, Inc. (Evenflo) is recalling certain Reo by Revolve360 child seats in color variants Nantucket, Danvers, Chelsea, Holden, Brookline, and Lenox. In certain rear or forward-facing positions, the headrest may shift position during a crash. It was determined that when the headrest is adjusted to its two highest positions (positions 10 and 11 in forward-facing mode and position 11 in rear-facing mode), the headrest may change position under certain conditions. This condition does not affect the safety of the car seat when the headrest is adjusted to positions 1 through 9 in forward-facing mode and positions 1 through 10 in rear-facing mode. As such, these child seats fail to comply with the requirements of Federal Motor Vehicle Safety Standard number 213, "Child Restraint Systems."

Model Numbers:

Model Name	Model Number	Date of Manufacturer
REO - Danvers	CS260212538	May 01, 2025 – June 30, 2026
REO - Chelsea	CS260212539	August 01, 2025 – June 30, 2026
REO - Brookline	CS260212521	April 01, 2025 – June 30, 2026
REO - Lenox	CS260212522	March 01, 2025 – June 30, 2026
REO - Holden	CS260212536	March 01, 2025 – June 30, 2026
REO - Nantucket	CS260212537	August 01, 2025 – June 30, 2026

Remedy: The remedy for this recall is currently under development. Interim letters, notifying owners of the safety risk, are expected to be mailed August 17, 2026. Additional letters will be sent once the remedy is available. If your child is tall enough to require use in position 10 or 11 (forward-facing) or 11 (rear-facing), contact the ParentLink® Consumer Care team by calling [1-800-233-5921](tel:1-800-233-5921), Monday through Friday from 8 AM - 5 PM EST, or email parentlink@evenflo.com. Owners may contact Evenflo customer service at 1-800-233-5921.

Notes: Owners may also contact the National Highway Traffic Safety Administration Vehicle Safety Hotline at 1-888-327-4236 (TTY 1-888-275-9171), or go to www.nhtsa.gov.

February 25, 2026 NHTSA Campaign Number: 26C002000 **Incorrect Information in Spanish Language Manual**

Safety Risk: A child of greater weight or height than specified in the correct instructions may be exposed to a greater risk of injury in the event of a crash. Incorrect information in the manual may result in an improperly restrained child, increasing the risk of injury in a crash.

Manufacturer: Evenflo Company, Inc.

Potential Number of Units Affected: 14,020

Summary: Evenflo Company, Inc. (Evenflo) is recalling certain LiteMax Factory Select child seats with model number CS100111198. The weight and height limitations are stated incorrectly in the Spanish language manual.

Remedy: Evenflo will mail owners a corrected Spanish language manual, free of charge. Owner notification letters are expected to be mailed March 31, 2026. Owners may contact Evenflo customer service at 1-800-233-5921.

Note: The [correct Spanish manual](#) is also available at

https://www.evenflo.com/cdn/shop/files/257000137S_Inst_LiteMax_30_ES_0226.pdf?v=5638690213888498782.

Notes: Owners may also contact the National Highway Traffic Safety Administration Vehicle Safety Hotline at 1-888-327-4236 (TTY 1-888-275-9171) or go to www.nhtsa.gov.

January 20 2026 NHTSA Campaign Number: 26C001000

Child Seat Missing Tether Strap

Safety Risk: A child seat with a missing tether strap may not adequately protect a child in a crash, increasing the risk of injury.

Manufacturer: Evenflo Company, Inc.

Potential Number of Units Affected: 64,031

Summary: Evenflo Company, Inc. (Evenflo) is recalling certain Titan 65 child seats with model numbers CS200312198, CS200311198, 3712198, and 3711198. The child seats may have been manufactured without a tether strap.

Remedy: Evenflo will advise owners to inspect their child seat for a tether strap, and Evenflo will mail owners a tether strap with installation instructions, as necessary, free of charge. Interim letters notifying owners of the safety risk are expected to be mailed February 20, 2026. Additional letters will be sent once the final remedy becomes available. Owners may contact Evenflo customer service at 1-800-233-5921.

Notes: Owners may also contact the National Highway Traffic Safety Administration Vehicle Safety Hotline at 1-888-327-4236 (TTY 1-888-275-9171) or go to www.nhtsa.gov.

December 24, 2025: NHTSA CAMPAIGN NUMBER: 25C011000 – Adjustable Recline Mechanism May Shift Out of Proper Position

Safety Risk: A child seat that does not maintain proper recline position may not adequately secure a child in a crash, increasing the risk of injury. Additionally, should another passenger put their hand in the recline mechanism when it shifts out of position, their risk of injury is increased.

Manufacturer: Evenflo Company, Inc.

Potential Number of Units Affected: 74,710

Summary: Evenflo Company, Inc. (Evenflo) is recalling certain All4One child seats. In rear-facing mode, the adjustable recline mechanism may shift out of proper position. As such, these child seats fail to comply with the requirements of Federal Motor Vehicle Safety Standard number 213, "Child Restraint Systems."

Model Numbers:

Model Name	Model Number	Date of Manufacturer
All4One DLX Latitude	39312234	July 01, 2022 – October 31, 2022
All4One DLX Reefs	39312240	July 01, 2022 – October 31, 2022
All4One Aries	39312408	January 01, 2022 – June 23, 2023
All4One Aries Pallet	39312408PAL	May 01, 2022 – July 31, 2022
All4One Ophelia	39312409	March 01, 2022 – April 30, 2023
All4One Knight	39312440	March 01, 2022 – March 31, 2023
All4One DLX Kingsley	39312441	January 01, 2022 – February 23, 2023
All4One DLX Kingsley	39312441COM	January 01, 2022 – November 30, 2022
All4One DLX Kingsley	39312441POP	February 01, 2022 – February 28, 2022
All4One DLX Belmont	39312442COM	March 01, 2022 – November 20, 2022

Remedy: Evenflo will replace the child seat, free of charge. Owner notification letters are expected to be mailed beginning January 26, 2026. Owners may contact Evenflo customer service at 1-800-233-5921.

Notes: Owners may also contact the National Highway Traffic Safety Administration Vehicle Safety Hotline at 1-888-327-4236 (TTY 1-888-275-9171) or go to www.nhtsa.gov.

September 25, 2025: NHTSA CAMPAIGN NUMBER: 25C010000 - Choking Hazard from Foam in Headrest

Safety Risk: A child breaking off pieces of the foam headrest may ingest them, creating a choking hazard, increasing the risk of injury. The headrest is accessible underneath the soft goods cover. The field experience demonstrates that the tape employed to protect against a child picking off pieces of foam does not extend sufficiently far to be fully effective.

Manufacturer: Evenflo Company, Inc.

Potential Number of Units Affected: 324997

Summary: Evenflo Company, Inc. (Evenflo) is recalling certain Gold Revolve360 Slim and Revolve360 Slim child seats manufactured between December 1, 2022, and December 8, 2024. Please refer to the list below of specific model and color information. The headrest foam is not adequately secured away from the child, which can allow the child to pick off pieces of foam.

Model Numbers:

Model Name	Model Number	Date of Manufacturer
Gold Revolve360 Slim Amethyst	36812451	March 01, 2024 - November 25, 2024
Gold Revolve360 Slim Amethyst	36812451AZ	July 01, 2024 - October 16, 2024
Gold Revolve360 Slim Obsidian	36812450	August 01, 2023 - August 06, 2024
Gold Revolve360 Slim Obsidian	36812450AZ	April 01, 2023 - December 05, 2024
Gold Revolve360 Slim Obsidian	36812450POP	March 01, 2023 - April 13, 2023
Gold Revolve360 Pearl Gray	36812449	Apr 01, 2023 - October 09, 2024
Gold Revolve360 Slim Pearl Gray	36812449AZ	May 01, 2024 - November 26, 2024
Gold Revolve360 Slim Peridot	36812504	December 01, 2023 - August 07, 2024
Revolve360 Slim Cambridge	36812501	January 01, 2023 - October 31, 2024
Revolve360 Slim Cambridge	36812501A	November 01, 2023 - April 21, 2024
Revolve360 Slim Canton	36812470	February 01, 2024 - November 27, 2024
Revolve360 Slim Canton	36812470A	December 01, 2022 - July 22, 2024
Revolve360 Slim Canton	36812470TGT	July 01, 2024 - September 04, 2024
Revolve360 Slim Carver	36812471	December 01, 2022 - August 15, 2024
Revolve360 Slim Salem	36812467AZ	December 01, 2022 - December 08, 2024
Revolve360 Slim Salem	36812467	December 01, 2022 - December 04, 2024
Revolve360 Slim Stow	36812468AZ	December 01, 2022 - December 01, 2024
Revolve360 Slim Stow	36812468	December 01, 2022 - November 26, 2024
Revolve360 Slim Sutton	36812469	March 01, 2023 - November 28, 2024
Revolve360 Slim Sutton	36812469AZ	September 01, 2023 - November 21, 2024

Remedy: Evenflo will supply consumers with a remedy kit including an additional tape seal. When installed by the consumer according to the accompanying instructions, the tape seal will protect against child access to the headrest foam. Owner notification letters are expected to be mailed October 31, 2025. Owners may contact Evenflo customer service at 1-800-233-5921.

Notes: Owners may also contact the National Highway Traffic Safety Administration Vehicle Safety Hotline at 1-888-327-4236 (TTY 1-888-275-9171) or go to www.nhtsa.gov.

June 18, 2025: NHTSA CAMPAIGN NUMBER: 25C008000 - Missing Instruction Manual/FMVSS 213

Safety Risk: Consumers who did not receive the correct instructions would not have ready access to accurate information about the proper installation and use of the subject child restraint, increasing the risk of incorrect usage and therefore the risk of injury in the event of a crash.

Manufacturer: Evenflo Company, Inc.

Potential Number of Units Affected: 36,694

Manufacture Dates: March 17, 2025 – May 1, 2025

Summary: Evenflo Company, Inc. (Evenflo) is recalling certain Titan 65 child seats.

Model Numbers: Titan 65: 371298

Identification of any warning that can occur: Where the incorrect instructions were provided, it is apparent because the cover of the instructions would recite a product name different from the subject product.

Remedy: Evenflo will give notice to identified purchasers explaining the potential issue, describing how they can check to make sure they have the correct instructions and communicating how they can obtain the correct instructions (free of charge) from Evenflo.

How remedy component differs from recalled component: The remedy component instructions are the correct instructions for the subject product, replacing instructions intended for a different product.

Notes: Owners may also contact the National Highway Traffic Safety Administration Vehicle Safety Hotline at 888-327-4236 (TTY 888-275-9171) or go to [nhtsa.gov](https://www.nhtsa.gov).

March 11, 2025: NHTSA CAMPAIGN NUMBER: 25C003000 - Missing Recall Registration Card/FMVSS 213

Safety Risk: A missing recall registration card may result in an unregistered child seat, which can delay recall notification and increase the risk of injury.

Manufacturer: Evenflo Company, Inc.

Potential Number of Units Affected: 1,068

Manufacture Dates: January 1, 2018 – December 31, 2024

Summary: Evenflo Company, Inc. (Evenflo) is recalling certain child seats and travel systems. The child seats and travel systems are missing the USA recall registration card. As such, these child seats and travel systems fail to comply with the requirements of Federal Motor Vehicle Safety Standard number 213, "Child Restraint Systems."

Model Numbers:

Model Name	Model Number	Date of Manufacturer
Symphony Sport Charcoal Shadow	34512335C	January 1, 2018 – December 31, 2024
Symphony Elite Paramount	34611709C	January 1, 2018 – December 31, 2024
Spectrum Cornerstone	34212036C	January 1, 2018 – December 31, 2024
Symphony DLX Ashland Gray	34612173C	January 1, 2018 – December 31, 2024
Symphony DLX Ocala	34631038C	January 1, 2018 – December 31, 2024
Sonus Lava Red	34712059C	January 1, 2018 – December 31, 2024
Maestro Sport Layton	34912200C	January 1, 2018 – December 31, 2024
Maestro Sport Crestone Peaks	34912258C	January 1, 2018 – December 31, 2024
Tribute Factory Select	3811198C	January 1, 2018 – December 31, 2024
Everystage DLX Canyons	39212241C	January 1, 2018 – December 31, 2024
Gold Shyft Travel System w/ LiteMax Moonstone	53212311C	January 1, 2018 – December 31, 2024
Pivot Travel System w/ Safemax Desert Tan	56012477C	January 1, 2018 – December 31, 2024
Sibby Travel System w/ Litemax ICS Rasp	56211976C	January 1, 2018 – December 31, 2024
Folio3 Travel System w/ Litemax Avenue	57312205C	January 1, 2018 – December 31, 2024
Litemax 35 Base	6391600C	January 1, 2018 – December 31, 2024
Everyfit All4One 3in1 Olympus	CS300212376C	January 1, 2018 – December 31, 2024
Go Time Sport Booster Vail	35012433C	January 1, 2018 – December 31, 2024
Gold Pivot Xpand Modular Travel System w/ LiteMax ICS - Moonstone Gray	53112311C	January 1, 2018 – December 31, 2024
Omni Plus Travel System w/ Litemax - Mylar Gray	53312418C	January 1, 2018 – December 31, 2024
Pivot Xpand Travel System w/ SM Ayrshire BK	57112454C	January 1, 2018 – December 31, 2024
Everykid 3in1 Livingston	CS300212340C	January 1, 2018 – December 31, 2024
Everyfit All4One 3in1 Aries	CS300212408C	January 1, 2018 – December 31, 2024
Big Kid LX Boston	31912381C	January 1, 2018 – December 31, 2024
AMP Performance Red	34011243C	January 1, 2018 – December 31, 2024
Gold Revolve360 Extend Moonstone	38412311C	January 1, 2018 – December 31, 2024

Remedy: Evenflo will mail owners a recall registration card, free of charge. Owner notification letters are expected to be mailed April 1, 2025. Owners may contact Evenflo customer service at 1-800-233-5921.

Notes: Owners may also contact the National Highway Traffic Safety Administration Vehicle Safety Hotline at 888-327-4236 (TTY 888-275-9171) or go to [nhtsa.gov](https://www.nhtsa.gov).

September 7, 2016: NHTSA CAMPAIGN NUMBER: 16C007000-Child Can Access/Loosen Harness Adjustment Button

Safety Risk: If the child can loosen the harness, they may not be properly secured in the event of a crash, increasing their risk of injury.

Manufacturer: Evenflo Company, Inc.

Potential Number of Units Affected: Dates: 29,742 Manufacture

- **Model # 34411700:** February 26, 2015 – February 9, 2016
- **Model # 34411741:** May 27, 2015 – February 9, 2016

Summary: Evenflo Company, Inc. (Evenflo) is recalling certain Evolve 3-in-1 Combination Booster Seats, model number 34411700 manufactured February 26, 2015, to February 9, 2016, and model number 34411741 manufactured May 27, 2015, to February 9, 2016. The affected seats have a button for adjusting the harness tightness. The child in the seat can access this button and loosen the harness without the caregiver's knowledge.

Remedy: Evenflo will notify the registered owners and will provide a remedy kit with a replacement harness adjustment button, free of charge. The recall began on September 28, 2016. Owners may contact Evenflo at www.evolve.evenflo.com or 1-800-233-5921.

Notes: Owners may also contact the National Highway Traffic Safety Administration Vehicle Safety Hotline at 1-888-327-4236 (TTY 1-800-424-9153) or go to www.safercar.gov.

Graco

April 2, 2026: NHTSA CAMPAIGN NUMBER: 26C003000

Infant seat carrier detaches from the base in a crash

Safety Risk: An infant seat carrier that detaches in a crash increases the risk of injury.

Manufacturer: Graco Children's Products Inc.

Potential Number of Units Affected: 5,126

Manufacture Dates: December 1, 2025 – March 27, 2026

Summary: Graco Children's Products Inc. (Graco) is recalling certain SnugRide Turn & Slide and Modes Nest Travel Systems with SnugRide Turn & Slide infant child seats. Please refer to Graco's recall report for specific model information. The infant seat carrier may detach from the base in a crash. As such, these child seats and travel systems fail to comply with the requirements of Federal Motor Vehicle Safety Standard number 213, "Child Restraint Systems." The SnugRide Turn & Slide Rotating Infant car seats, sold in the US by Amazon, Babylist, Target, Walmart, and GracoBaby.com.

Model Numbers:

Model Name	Model Number	Date of Manufacturer
Replacement product available at no cost for affected consumers after registration review. Option 1: SnugRide SnugFit DLX Maison (2156211) + additional SnugRide SnugFit base (2120612) Option 2: SnugRide SnugFit Gotham (2121500) + additional SnugRide SnugFit base (2120612) Option 3: EasyTurn Solae (2216076) / Option 4: Turn2Me Brighton (2215409)		
SnugRide Turn & Slide Rotating ICS	2231809 Noir / Black	January 1, 2026 – March 31, 2026
SnugRide Turn & Slide Rotating ICS	2231887 Sandstone / Tan	January 1, 2026 – March 31, 2026
SnugRide Turn & Slide Rotating ICS	2231806 Mulberry / Girl-Plum	January 1, 2026 – March 31, 2026
SnugRide Turn & Slide Rotating ICS	2231885 Sandstone / Tan	January 1, 2026 – March 31, 2026
SnugRide Turn & Slide Rotating ICS	2231881 Noir / Black	January 1, 2026 – March 31, 2026
SnugRide Turn & Slide Rotating ICS	2231884 Noir / Black	January 1, 2026 – March 31, 2026
Included only when the product label matches the affected model number listed here. If you are registering a base-only product (model 2231810), you will receive SnugRide SnugFit base (2120612) only. Base-only registrations are not eligible for full car seat replacement options.		
SnugRide® Turn & Slide Rotating Infant Car Seat Base	2231810 Black	January 1, 2026 – March 31, 2026
The stroller is not affected. Both infant car seat replacement options are designed to work with your existing travel system stroller		
Modes Nest Travel System with SnugRide® Turn & Slide ICS	2243083 Noir / Black	January 1, 2026 – March 31, 2026

Remedy: Owners are advised to follow the instructions for installing the child seat with the vehicle seat belt (without the base) until the replacement seat arrives. Graco will replace the child seat, free of charge. Owner notification letters are expected to be mailed April 2026. Owners may contact Graco customer service at 1-800-345-4109.

Go to <https://recalls.gracobaby.com/> and complete the registration form. Upload a photo of the label with the model number, manufacture date, and serial number. Select one of the replacement options and submit the registration form to Graco for review and if your car seat is affected, your selected replacement will be provided. If you have questions, please contact our Graco Consumer Services team via chat, email or by phone at 1-800-345-4109 between 9 a.m. – 5 p.m. ET, Monday thru Friday.

Notes: Owners may also contact the National Highway Traffic Safety Administration Vehicle Safety Hotline at 1-888-327-4236 (TTY 1-888-275-9171), or go to www.nhtsa.gov.

May 10, 2017: NHTSA CAMPAIGN NUMBER: 17C001000 - Child Seat Webbing may Tear Under Load/FMVSS 213

Safety Risk: A child that is not adequately restrained in a crash has an increased risk of an injury.

Manufacturer: Graco Children's Products Inc.

Potential Number of Units Affected: 25,494

Manufacture Dates: May 20, 2014 – August 1, 2014

Summary: Graco Children's Products Inc. (Graco) is recalling certain Graco My Ride 65 convertible child restraints, models 1871689, 1908152, 1813074, 1872691, 1853478, 1877535, 1813015, and 1794334. In the event of a crash, the child seat webbing may not adequately restrain the child. As such, these car seats fail to conform to Federal Motor Vehicle Safety Standard (FMVSS) number 213, "Child Restraint Systems."

Remedy: Graco will notify owners, and dealers will provide consumers with a replacement harness, free of charge. The recall began on July 7, 2017. Owners may contact Graco customer service at 1-800-345-4109.

Notes: Owners may also contact the National Highway Traffic Safety Administration Vehicle Safety Hotline at 1-888-327-4236 (TTY 1-800-424-9153) or go to www.safercar.gov.

Harmony Juvenile Products

April 17, 2018: NHTSA CAMPAIGN NUMBER: 18C001000 - Booster Seat Excessive Force/FMVSS 213

Safety Risk: Excessive chest force can increase the risk of injury.

Manufacturer: Harmony Juvenile Products

Potential Number of Units Affected: 148,165

Manufacture Dates: November 1, 2015 – June 24, 2017

Summary: Harmony Juvenile Products (Harmony) is recalling certain Harmony Big Boost Deluxe booster seats. In the event of a crash, the seat belt may cause excessive force to be applied to the restrained child's chest. As such, these booster seats fail to comply with the requirements of Federal Motor Vehicle Safety Standard (FMVSS) number 213, "Child Restraint Systems."

Remedy: Harmony will notify owners and provide a replacement booster seat of a different model, free of charge to eligible U.S. consumers who currently own a Big Boost unit and are the original purchaser, original owner, and/or original user of the Big Boost unit. Interim notices informing owners of the safety risk were mailed August 21, 2018. The recall began July 3, 2020. Owners may contact Harmony customer service at 1-877-306-1001.

Notes: Owners may also contact the National Highway Traffic Safety Administration Vehicle Safety Hotline at 1-888-327-4236 (TTY 1-800-424-9153) or go to www.safercar.gov.

Marainbow (JD E-Commerce America Limited)

December 29, 2022 NHTSA CAMPAIGN NUMBER: 22C008000 - Child Seat May Be Improperly Installed/FMVSS 213

Safety Risk: An incorrect installation label may result in an improperly installed child seat, increasing the risk of injury in a crash.

Manufacturer JD E-Commerce America Limited

Potential Number of Units Affected 174



Manufacture Dates: August 2, 2020 – May 7, 2022

Summary: JD E-Commerce America Limited (Joybuy Express) is recalling all Marainbow Portable Infant Safe Seat and materially similar child seats. Please refer to Joybuy Express' affected products attachment for specific child seat model details. The installation labels display incorrect instructions. The child seat's design also prohibits it from being installed properly. As such, these child seats fail to comply with the requirements of Federal Motor Vehicle Safety Standard number 213, "Child Restraint Systems."

Remedy: Joybuy Express will provide a refund to purchasers. The manufacturer has not yet provided a schedule for recall notification. Owners may contact Joybuy Express' customer service at 1-302-426-4543. This recall expands and replaces NHTSA recall number 22C-007.

Notes: Owners may also contact the National Highway Traffic Safety Administration Vehicle Safety Hotline at 1-888-327-4236 (TTY 1-800-424-9153) or go to www.nhtsa.gov.

November 28, 2022 NHTSA CAMPAIGN NUMBER: 22C007000 - Incorrect Installation Label and Design/FMVSS 213

Safety Risk: An incorrect installation label may result in an improperly installed child seat, increasing the risk of injury in a crash.

Manufacturer JD E-Commerce America Limited

Potential Number of Units Affected 174

Manufacture Dates: August 2, 2020 – May 7, 2022



Summary: JD E-Commerce America Limited (JD E-Commerce) is recalling certain Marainbow Portable Infant Safe Seat child seats. The installation labels display incorrect instructions. The child seat's design also prohibits it from being installed properly. As such, these child seats fail to comply with the requirements of Federal Motor Vehicle Safety Standard number 213, "Child Restraint Systems."

Remedy: No remedy has been established at this time. The manufacturer has not yet provided a schedule for recall notification. Owners may contact JD E-Commerce customer service at 1-946-932-0299.

Notes: Owners may also contact the National Highway Traffic Safety Administration Vehicle Safety Hotline at 1-888-327-4236 (TTY 1-800-424-9153) or go to www.nhtsa.gov.

Merritt Manufacturing

November 5, 2019: NHTSA CAMPAIGN NUMBER: 19C003000 - Harness may not Restrain Child in a Crash

Safety Risk: In the event of a crash, the harness may not restrain the bed occupant, increasing their risk of injury.

Manufacturer: Merritt Manufacturing Inc.

Potential Number of Units Affected: 216

Manufacture Dates: August 8, 2019 – October 24, 2019

Summary: Merritt Manufacturing Inc. (Merritt) is recalling certain Angel Guard Angel Ride car beds. The restraint harness may not have been properly sewed where the buckle is attached.

Remedy: Merritt will notify owners, and will provide replacement harnesses, free of charge. The recall began January 15, 2020. Owners may contact Merritt customer service at 1-317-409-0146.

Notes: Owners may also contact the National Highway Traffic Safety Administration Vehicle Safety Hotline at 1-888-327-4236 (TTY 1-800-424-9153) or go to www.safercar.gov.

Nuna Baby Essentials, Inc

November 27, 2024: NHTSA CAMPAIGN NUMBER: 24C002000 - Front Harness Adjuster on Child Seat May Fail

Safety Risk: In the event of a crash, the front harness may not restrain the child, increasing their risk of injury.

Manufacturer Nuna Baby Essentials, Inc.

Potential Number of Units Affected: 608,786

Manufacture Dates: July 16, 2016 – October 25, 2023

Summary: Nuna Baby Essentials, Inc. (Nuna) is recalling certain Rava child seats with a plastic harness adjuster button, manufactured between July 16, 2016 and October 25, 2023. Please see the recall report for a complete list of model numbers. Debris may enter the front harness adjuster and cause the mechanism to fail, resulting in a loose harness.

Remedy: Nuna will provide owners a remedy kit, free of charge. The manufacturer has not yet provided a schedule for recall notification. Owners may contact Nuna customer service at 1-855-686-2891 or via email at info.usa@nunababy.com.

Notes: Owners may also contact the National Highway Traffic Safety Administration Vehicle Safety Hotline at 1-888-327-4236 (TTY 1-800-424-9153) or go to www.nhtsa.gov.

WAYB

August 30, 2019: NHTSA CAMPAIGN NUMBER: 19C001000 - Headrest May Break or Separate From Car Seat

Safety Risk: A broken or separated headrest increases the risk of injury during a crash.

Manufacturer: ForB dba WAYB

Potential Number of Units Affected: 6,426

Manufacture Dates: February 1, 2019 - August 23, 2019

Summary: ForB dba WAYB (WAYB) is recalling certain WAYB Pico child seats manufactured between February 1, 2019, and August 23, 2019. The headrest's aluminum tubular frame can break allowing the headrest to detach.

Remedy: The manufacturer is still developing a plan to replace the headrests on the affected seats, free of charge. The recall began November 12, 2019. Owners may contact WAYB customer service at help@wayb.com or 1-888-924-9292.

Notes: Owners may also contact the National Highway Traffic Safety Administration Vehicle Safety Hotline at 1-888-327-4236 (TTY 1-800-424-9153) or go to www.safercar.gov.

4 MOMS

December 30, 2016: NHTSA CAMPAIGN NUMBER: 16C009000 - Infant Carrier may not Secure to Base

Safety Risk: If the infant carrier does not properly attach to the base, the carrier can detach in a crash, increasing the risk of injury.

Manufacturer: THORLEY INDUSTRIES D/B/A 4MOMS

Potential Number of Units Affected: 1,622

Manufacture Dates: July 1, 2016 - October 31, 2016

Summary: Thorley Industries LLC d/b/a 4moms (4moms) is recalling certain 4moms Self Installing Rear-facing Infant Car Seats, model number 1032, manufactured July 1, 2016, to October 31, 2016. Due to a tight rivet, the affected car seats have a coupling hook that may not properly engage around the coupling pin, preventing the infant carrier portion from securely attaching to the seat base.

Remedy: 4moms will notify owners and will replace the infant carrier portion, free of charge. The recall began on January 10, 2017. Owners may contact 4moms at 4moms.com/recalls or by calling 1-888-614-6667.

Notes: Owners may also contact the National Highway Traffic Safety Administration Vehicle Safety Hotline at 1-888-327-4236 (TTY 1-800-424-9153) or go to www.safercar.gov.