

IMPORTANT SAFETY RECALL

NHTSA Recall 21C-005

Clek Inc. has decided that a defect which relates to motor vehicle safety exists in Clek Foonf and Fllo Convertible Car Seats manufactured <u>prior to May 21, 2021</u>.

Clek Foonf convertible car seat affected:

Model Name: Manufactured on:

F012, F014, F015, F016, F017, F018, F019 2012/12/03 - 2021/05/20

Clek Fllo convertible car seat affected:

 Model Name:
 FL15, FL16, FL17, FL18, FL19

 Manufactured on:
 2014/07/05 - 2021/05/20

Mode Name Portego de la constantion Montificater de la const

Description of the safety defect:

Clek has determined that it is possible for a child to place their fingers through the crotch buckle opening and pick at the foam seat cushion on the subject car seats. After repeated picking, a child may be able to remove small pieces of Expanded Polypropylene (EPP) foam and put the small pieces into their mouth, posing a potential choking hazard and increasing the risk of injury. The foam pieces that are picked off are small (about 5 mm) with no sharp edges. This foam is non-toxic and does not pose a chemical concern if it were to be ingested.

This issue does NOT affect the ability of the child restraint system to protect the occupant in the event of a motor vehicle crash.

Remedy of the safety defect:

Clek will be providing a plastic insert to cover the foam around the crotch buckle opening to help prevent access to the foam. It is safe to use your car seat while waiting to receive a kit to fix the issue.

Clek will notify all registered owners of affected car seats. This notice will explain the issue and include instructions for how to get a free kit to fix the issue.

Owners of affected car seats who have not registered their car seat, or have moved, can contact Clek at <u>customerservice@clekinc.com</u> or by telephone at 1(866) 656-2462.

Crotch buckle opening



Serial Number

EPP foam seat cushion



EPP foam seat cushion with platic insert installed



Manufactured on Date

Cretch hurdele energine